# General **Specifications**

# EXAXI

Direct In Situ Zirconia Oxygen Analyzers and High Temperature Humidity Analyzers

Model ZR22G, ZR402G, and ZR202G

# GS 11M12A01-01E

# **Overview**

This analyzer consists basically of a probe and a converter that are used as both a Zirconia Oxygen Analyzer and High Temperature Humidity Analyzer. The probe is of direct insertion type, and the converter uses a digital display.

Two types of analyzers are available: separate type and integrated type. As its name implies, the integrated type combines probe and converter.

Separate and integrated type Zirconia oxygen analyzers need not use a sampling device, and allow direct installation of the probe in the wall of a flue or furnace to measure the concentration of oxygen in the stack gas. The converter displays the cell temperature and cell emf in addition to the oxygen concentration.

This analyzer is most suitable for monitoring the oxygen concentration of combustion gases in large or small boilers, various industrial furnace and combustion devices, or for the control of low-oxygen combustion.

Separate type and integrated type Zirconia High Temperature Humidity Analyzers are used to measure the humidity of hot gases continuously in driers which use an electrical heater or hot gas as the heat source. They can also be used in a variety of manufacturing applications in humidifiers, as well as in driers, for humidity measurement and control. They can help improve productivity in these application fields.

# Features:


- . The built-in heater assembly of the probe can be replaced on site, reducing maintenance costs.
- The probe uses a long-life, high-reliability Zirconia sensor.
- The probe uses three-reference gas supply methods (natural air convection, instrument air, and pressure compensated) in its applications.
- The separate type converter incorporates a LCD touchscreen for ease of operation.





ZR202G

- · This converter can be used as an oxygen analyzer as well as a high temperature humidity analyzer.
- The integrated type integrates both probe and converter, to reduce wiring, piping, and installation costs. This type of unit uses an optical switch for ease of operation at the site.
- Remote maintenance using digital communications (HART) reduces maintenance costs. \*1
  - \*1: HART is a registered trademark of HART Communication Foundation

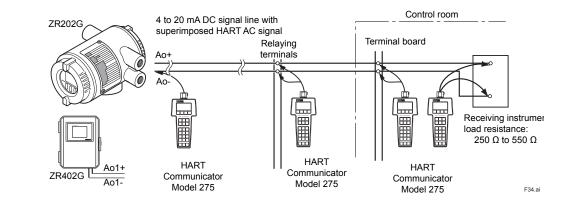



Yokogawa Electric Corporation 2-9-32, Nakacho, Musashino-shi, Tokyo, 180-8750 Japan Tel.: 81-422-52-5617 Fax.: 81-422-52-6792


GS 11M12A01-01E ©Copyright June 2000 13th Edition Feb 2016

# **Basic System Configuration**

#### System configuration - Separate type

System configuration Example 1 of Separate type Analyzer


- Automatic calibration system uses instrument air for reference gas.
- For the calibration gas, a standard gas cylinder may be used for more accurate calibration.
- Applications: Oxygen concentration monitoring and control in large boilers (for private power generation and for business use) and in heating furnaces, and the like. Humidity monitoring and control in drying furnaces and humidifiers.

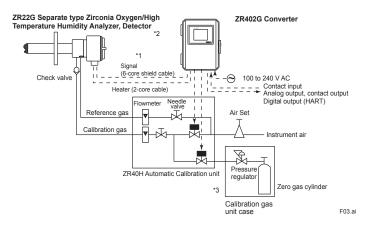

#### System configuration - Integrated type

System configuration Example 1 of Integrated type Analyzer

- Automatic calibration system uses instrument air for reference gas.
  - For the calibration gas, a standard gas cylinder may be used for more accurate calibration.
- Applications: Oxygen concentration monitoring and control in large boilers
  - (for private power generation and for business use) and in heating furnaces, and the like. Humidity monitoring and control in drying furnaces and humidifiers.

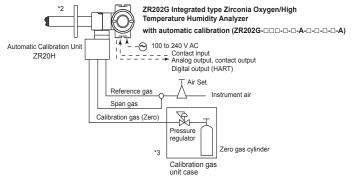

Note

The installation temperature limits range for integrated type analyzer is -20 to  $55^\circ\text{C}.$   $_{\text{F05.ai}}$ 


- \*1 Shield cable:
- Use shielded signal cables, and connect the shields to the FG terminal of the converter.
- \*2 Select the desired probe from the Probe Configuration table on page 4.
- \*3 When a zirconia oxygen analyzer is used, 100% N<sub>2</sub> gas cannot be used as the zero gas. Use approx. 1 vol% O<sub>2</sub> gas (N<sub>2</sub>-balanced).

# **Basic System Configuration**

#### System configuration — Separate type

System configuration Example 2 of Separate type Analyzer

- Instrument air is used as the reference gas. A standard gas cylinder can be used for the calibration gas for more accurate calibration.
- Application example: Oxygen concentration monitoring and control in large boilers (for private power generation and for business use) and in heating furnaces.
   Humidity monitoring and control in drying furnaces and humidifiers.

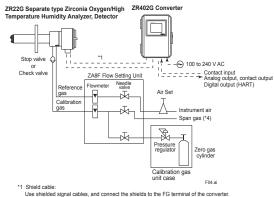


Use shielded signal cables, and connect the shields to \*4 Calibration gas unit same as for zero gas.

# System configuration — Integrated type


System configuration Example 2 of Integrated type Analyzer

- Instrument air is used as the reference gas. A standard gas cylinder can be used for the calibration gas for more accurate calibration.
- Application example: Oxygen concentration monitoring and control in large boilers (for private power generation and for business use) and in heating furnaces.
   Humidity monitoring and control in drying furnaces and humidifiers.

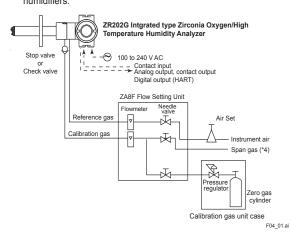

System configuration Example 3 of Separate type Analyzer


- Ambient air is used as the reference gas. A portable standard gas unit (ZO21S) is used for the calibration.
- This unit is connected only when the calibration is made • Application example:
- Oxygen concentration monitoring and control in packaged boilers
- Humidity monitoring and control in drying furnaces or a humidifiers

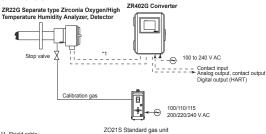

\*1 Shield cable: Use shielded signal cables, and connect the shields to the FG terminal of the converter F02\_01.a System configuration Example 3 of Integrated type Analyzer

- Ambient air is used as the reference gas. A portable standard gas unit (ZO21S) is used for the calibration. This unit is connected only when the calibration is made.
- Application example:

Oxygen concentraion monitoring and control in packaged boilers Humidity monitoring and control in drying furnaces or a humidifiers

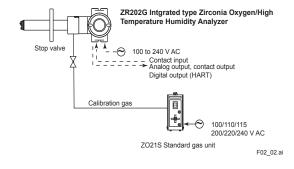

Note: The installation temperature limits range for integrated type analyzer is -20 to 55°C.

### **System Components**

		Sepa	arate	уре	Integ	grated	type
	System Components	Syst	em co	onfig.	System config.		
	System Components	Ex.1	Ex.2	Ex.3	Ex.1	Ex.2	Ex.3
1	Model ZR22G Separate type Zirconia Oxygen / High Temperature Humidity Analyzers, Detector						
2	Model ZR402G Separate type Zirconia Oxygen / High Temperature Humidity Analyzer, Converter(*1)						
3	Model ZR202G Integrated type Zirconia Oxygen / High Temperature Humidity Analyzers						
4	Model ZO21P High Temperature Probe Adapter for separate type Zirconia Oxygen Analyzer	0	0	0			
5	E7046EC, E7046EN Auxiliary Ejector Assembly for High Temperature Probe of separate type Oxygen Analyzer	0	0	0			
6	Model ZO21R Probe Protector for Zirconia Oxygen Analyzers	0	0	0	0	0	0
7	K9471UA Dust Filter for Oxygen Analyzer	0	0	0	0	0	0
8	K9471UC Dust Guard Protector	0	0	0	0	0	0
9	Model ZH21B Dust Protector for High Temperature Humidity Analyzers	0	0	0	0	0	0
10	Model ZO21S Standard Gas Unit						
11	Model ZA8F Flow Setting Unit for manual calibration						
12	Model ZR40H Automatic Calibration Unit for Separate type Analyzers						
13	Model ZR20H Automatic Calibration Unit for Integrated type Analyzers (*2)						
14	L9852CB, G7016XH Stop Valve for Calibration gas line		( )			(●)	
15	K9292DN, K9292DS Check Valve for Calibration gas line		(●)			(●)	
16	G7003XF/K9473XK, G7004XF/K9473XG Air Set						
17	G7001ZC Zero gas Cylinder				٠		
18	G7013XF, G7014XF Pressure Regulator for Gas Cylinder						
19	E7044KF Case Assembly for Calibration gas Cylinder						
20	ZR22A, ZR202A Heater Assembly for Spare Parts	0	0	0	0	0	0

• : Items required for the above system example

 $\boldsymbol{\mathsf{O}}$  : To be selected depending on each application. For details, refer to Chapter of Options.

(●) : Select either

(\*1): When used as a high temperature humidity analyzer, specify /HS options.

(\*2): When Automatic Calibration of (-A) or (-B) code is speified , ZR20H is installed in ZR202G.

#### **Detector Components**

	Sample	e gas temperature 0 to 700°C	Sample gas temperature 700 to 1400°C		
Mounting	Insertion length	General-use Probe	Application	High temperature detector	Application
Horizontal to vertical	0.4 to 2 m	Detector (ZR22G or ZR202G)	Boiler Heating furnace	Sample outlet Absorption Structure Probe adapter for high	Heating furnace
Vertical	2.5 m or more			temperature use ZO21P-H Sample inlet	
Horizontal to vertical	3 m or less	Probe Protector Gas Flow (ZO21R) Sample inlet	For pulverized coal boiler with gas flow velocity 10 m/sec or more	Temperature: Probe material; SUS310S 800°C Probe material; SiC 1400°C Mounting: Vertical downwards Insertion length: 1.0 m, 1.5 m When duct pressure is atmospheric or negative, attach air ejector. High temperature auxiliary ejector assembly (E7046EC, E7046EN)	
Horizontal to vertical	0.4 to 2 m	Dust filter for Oxygen Analyzer (K9471UA) Detector(ZR22G or or ZR202G)	Black liquid recovery boiler Cement Kiln	Needle valve	
Vertical	2.5 m or more	Dust guard protector (K9471UC) +			

F06.ai

T01.ai

4

# STANDARD SPECIFICATIONS (Oxygen Analyzer)

#### **Example of Application**

Separate and integrated type Zirconia Oxygen Analyzers

- · Large, medium and small boilers (boilers for power generation: heavy oil, gas or coal)
- Various industrial furnaces (refinery process/iron manufacture heating furnace, coal kiln, and black liquid recovery boilers) For other applications, contact Yokogawa Electric Corporation.
- · May not be applicable corrosive gas such as ammonia, chlorine is present-check wit YOKOGAWA.

#### **General Specifications**

#### **Oxygen Analyzer**

Measurement Object: Oxygen concentration in combustion exhaust gas and mixed gas (excluding inflammable gases may not be applicable corrosive gas such as ammonia, chlorine is present-check with YOKOGAWA.

Measurement System: Zirconia system

- Measurement Range: 0.01 to 100 vol% O<sub>2</sub> Output Signal: 4 to 20 mA DC (maximum load resistance 550  $\Omega$ )
- Setting Range: Any setting in the range of 0 to 5 through 0 to 100 vol%  $O_2$  (in 1 vol%  $O_2$ ), or partial range
- Digital Communication (HART): 250 to 550  $\Omega$ , depending on number of field devices connected to the loop (multi-drop mode).

Display Range: 0 to 100 vol% O<sub>2</sub>

- Warm-up Time: Approx. 20 min.
- Repeatability: (Excluding the case where the reference gas is by natural convection) ± 0.5% Maximum value of set range; range from 0 to 5 vol% O2 or more and less than 0 to 25 vol% O2 range ± 1% Maximum value of set range; range from 0 to 25 vol%  $O_2$  or more and up to 0 to 100 vol% O<sub>2</sub> range
- Linearity: (Excluding standard gas tolerance) (Excluding the case where the reference gas is by natural convection) (Use oxygen of known concentration (with in the measuring range) as the zero and span calibration gases.) ± 1% Maximum value of set range; 0 to 5 vol% O2 or more and less than 0 to 25 vol% O<sub>2</sub> range (Sample gas pressure: within ± 4.9 kPa) ± 3% Maximum value of set range; 0 to 25 vol% O2 or more and less than 0 to 50

vol% O2 range (Sample gas pressure: within ± 0.49 kPa) ± 5% Maximum value of set range; 0 to 50 vol% O<sub>2</sub> or more and up to 0 to 100 vol% O<sub>2</sub> range

(Sample gas pressure: within  $\pm 0.49$  kPa) Drift: (Excluding the first two weeks in use)

(Excluding the case where the reference gas is by natural convection.) Both zero and span ± 2% Maximum value of set range/month

- Response Time: Response of 90% within 5 seconds. (Measured after gas is introduced from calibration gas inlet and analog output starts changing.)
- Safety, EMC and RoHS conformity standards for the ZR22G, ZR402G and ZR202G
- Installation altitude based on IEC 61010: 2000 m or less
- Category based on IEC 61010: II (Note)
- Pollution degree based on IEC 61010: 2 (Note) Note: Installation category, called over-voltage category, specifies impulse withstand voltage. Category II is for electrical equipment. Pollution degree indicates the degree of existence of solid, liquid, gas or other inclusions which may reduce dielectric strength. Degree 2 is the normal indoor environment.
- EN 61010-1, EN 61010-2-030, Safety: CAN/CSA-C22.2 No. 61010-1, UL Std. No. 61010-1
- EMC: EN 61326-1 Class A, Table 2, EN 61326-2-3, EN 61000-3-2 EMC Regulatory Arrangement in Australia and New Zealand (RCM) EN61326-1 Class A Korea Electromagnetic Conformity Standard
- Note: This instrument is a Class A product, and it is designed for use in the industrial environment. Please use this instrument in the industrial environment only. RoHS: EN 50581

#### 1. ZR22G Separate type Zirconia Oxygen Analyzer, Detector

- **Oxygen Analyzer** 
  - Sample Gas Temperature: 0 to 700°C (Probe only) It is necessary to mount the cell using Inconel cell-bolts when the temperature is greater than 600°C. For high temperature sample gas (700 to 1400°C), apply 0.15 m length probe and High Temperature Probe Adapter ZO21P-H.
  - Sample Gas Pressure: 5 to + 250 kPa (When the pressure in the furnace exceeds 3 kPa, it is recommended to use pressure compensated type. When the pressure in the furnace exceeds 5 kPa, pressure compensated type is required.) For 0.15 m probe, - 0.5 to + 5 kPa. No pressure fluctuation in the furnace should be allowed.
  - Note: When the detector is used in conjunction with a check valve and the ZA8F Flow Setting Unit, the maximum pressure of sample gas is 150 kPa. When with a check valve and the ZR40H Automatic Calibration Unit, it is 200 kPa. If the pressure of your sample gas exceeds these limits, consult with Yokogawa.
  - Probe Length: 0.15, 0.4, 0.7, 1.0, 1.5, 2.0, 2.5, 3.0, 3.6, 4.2, 4.8, 5.4 m Probe Material: SUS316 (JIS) Ambient Temperature: -20 to +150°C Reference Gas System: Natural Convection,

  - - Instrument Air, Pressure compensated (other than for probe length 0.15 m)

Consumption; Approx. 1 NI/min Wetted Material: SUS316 (JIS), Zirconia, SUS304 (JIS) or ASTM grade 304 (flange), Hastellov B, (Inconel 600, 601) Construction: Heater and thermocouple replaceable construction. Non explosion-proof JIS C0920 / equivalent to IP44D. Equivalent to NEMA 4X/IP66 (Achieved when the cable entry is completely sealed with a cable gland in the recirculation pressure compensated version.) Terminal Box Case: Material; Aluminum alloy Terminal Box Paint Color: Case; Mint green (Munsell 5.6BG3.3/2.9) Cover; Mint green (Munsell 5.6BG3.3/2.9) Polyurethane corrosion-resistance coating Finish<sup>.</sup> Gas Connection: Rc1/4 or 1/4 NPT (Female) Wiring Connection: G1/2, Pg 13.5, M20 × 1.5, 1/2 NPT Installation: Flange mounting Probe Mounting Angle: Horizontal to vertically downward. When the probe insertion length is 2 m or less, installing at angles from horizontal to vertically downward is possible. When the probe insertion length is 2.5 m or more, mount vertically downward (within  $\pm 5^{\circ}$ ) and use a probe protector. Weight: Insertion length of 0.4 m: approx. 6 kg (JIS 5K 65) / approx. 11 kg (ANSI 150 4) Insertion length of 1.0 m: approx. 8 kg (JIS 5K 65) / approx. 13 kg (ANSI 150 4) Insertion length of 1.5 m: approx. 10 kg (JIS 5K 65) / approx. 15 kg (ANSI 150 4) Insertion length of 2.0 m: approx. 12 kg (JIS 5K 65) / approx. 17 kg (ANSI 150 4) Insertion length of 3.0 m: approx. 15 kg (JIS 5K 65) / approx. 20 kg (ANSI 150 4) Insertion length of 3.6 m: approx. 17 kg (JIS 5K 65) / approx. 22 kg (ANSI 150 4) Insertion length of 4.2 m: approx. 19 kg (JIS 5K 65) / approx. 24 kg (ANSI 150 4) Insertion length of 4.8 m: approx. 21 kg (JIS 5K 65) / approx. 26 kg (ANSI 150 4) Insertion length of 5.4 m: approx. 23 kg (JIS 5K 65) / approx. 28 kg (ANSI 150 4) 2. ZR402G Separate type Zirconia Oxygen Analyzer, Converter **Oxygen Analyzer** Operated using an LCD touchscreen on the converter. Display: LCD display of size 320 by 240 dot with touchscreen. Output Signal: 4 to 20 mA DC, two points (maximum load resistance 550  $\Omega$ ) Contact Output Signal: Four points (one is fail-safe, normally open) Contact Input: Two points Automatic Calibration Output: Two points (for dedicated automatic calibration unit) Ambient Temperature: -20 to +55°C All Rights Reserved. Copyright © 2000, Yokogawa Electric Corporation

Instrument Air System (excluding Natural Convection):

or oil mist are removed.)

Pressure; 200 kPa + the pressure inside

which has been dehumidified by cooling

to dew point -20°C or less, and dust

the furnace. (It is recommended to use air

- Storage Temperature: -30 to +70°C Ambient Humidity: 0 to 95% RH (non-condensing) Power Supply Voltage: Ratings; 100 to 240 V AC Acceptable range; 85 to 264 V AC Power Supply Frequency: Ratings; 50/60 Hz Acceptable range; 45 to 66 Hz Power Consumption: Max. 300 W, approx. 100 W for ordinary use. Maximum Distance between Detector and Converter: Conductor two-way resistance must be 10  $\Omega$  or less (when a 1.25 mm<sup>2</sup> cable or equivalent is used, 300 m or less.) Construction: Outdoor installation, equivalent to NEMA 4X/IP66 (with conduit holes completely sealed with a cable gland) Wiring Connection: G1/2, Pg 13.5, M20 × 1.5, 1/2 NPT (with plug), eight holes Installation: Panel, wall or 2-inch pipe mounting Case: Aluminum alloy Paint Color: Door: Silver gray (Munsell 3.2PB7.4/1.2) Case: Silver gray (Munsell 3.2PB7.4/1.2)
- Finish: Polyurethane corrosion-resistance coating Weight: Approx. 6 kg
- **Functions** 
  - **Display Functions:** 
    - Value Display; Displays values of the measured oxygen concentration, etc Graph Display; Displays trends of measured
    - oxygen concentration Data Display; Displays various useful data for

maintenance, such as cell temperature, reference junction temperature, maximum/minimum oxygen concentration, or the like

- Status Message; Indicates an alarm or error occurrence by flashing of the corresponding icon. Indicates status such as warming-up, calibrating, or the like by the marks.
- Alarm, Error Display; Displays alarms such as "Abnormal oxygen concentration" or errors such as "Abnormal cell e.m.f." when any such status occurs.

Calibration Functions:

Automatic Calibration; Requires the ZR40H Automatic Calibration Unit. It calibrates automatically at specified intervals.

- Semi-automatic Calibration; Requires the ZR40H Automatic Calibration Unit. Input calibration direction on the touchscreen or contact, then it calibrates automatically afterwards.
- Manual Calibration; Calibration with opening/closing the valve of calibration gas in operation interactively with an LCD touchscreen.
- Blowback Function: Output through the contact in the set period and time. Auto/Semi Auto selectable.
- Maintenance Functions:

Can operate updated data settings in daily operation and checking. Display data settings, calibration data settings, blowback data settings, current output loop check, input/output contact check.

Setup Functions:	Range:	Any setting between 0 to 5 through 0
Initial settings suit for the plant conditions	0	to 100 vol% $O_2$ in 1 vol% $O_2$ , or partial
when installing the converter. Equipment		range is available (Maximum range
settings, current output data settings,		value/minimum range value 1.3 or more)
alarm data settings, contact data settings,		For the log output, the minimum range
other settings.		value is fi xed at 0.1 vol% $O_2$ .
Self-diagnosis:		4 to 20 mA DC linear or log can be
This function diagnoses conditions of the		selected. Input/output isolation.
converter or the detector and indicates		
when any abnormal condition occurs.		
Password Functions:	Output dam	nping: 0 to 255 seconds. Hold/non-hold
Enter your password to operate the		selection, preset value setting possible
analyzer excepting data display. Individual		with hold.
passwords can be set for maintenance		tput: Four points, contact capacity 30 V
and setup.		DC 3 A, 250 V AC 3 A (resistive load).
Display and setting content:		Three of the output points can be selected
Measuring Related Items: Oxygen concentration		to either normally energized or normally
$(vol\% O_2)$ , output current value (mA), air		deenergized status.
ratio, moisture quantity (in hot gases)		Delayed functions (0 to 255 seconds)
(vol% H <sub>2</sub> O)		and hysteresis function (0 to 9.9 vol $(O_2)$ )
Display Items: Cell temperature (°C), thermocouple		can be added to high/low alarms.
reference junction temperature (°C),		The following functions are programmable
maximum/minimum/average oxygen		for contact outputs.
concentration (vol% O <sub>2</sub> ), cell e.m.f. (mV),		(1) Abnormal, (2) High-high alarm, (3)
cell internal resistance ( $\Omega$ ), cell condition		High alarm, (4) Low-low alarm, (5) Low
(in four grades), heater on-time rate (%), calibration record (ten times), time		alarm, (6) Maintenance, (7) Calibration,
		(8) Range switching answer-back, (9)
(year/month/day, hour/minute)		Warm-up, (10) Calibration gas pressure
Calibration Setting Items: Span gas concentration		decrease (answer-back of contact
$(vol\% O_2)$ , zero gas concentration $(vol\% O_2)$ , adibration mode (automatic sami		input), (11) Temperature high alarm,
$O_2$ ), calibration mode (automatic, semi-		(12) Blowback start, (13) Flameout gas
automatic, manual), calibration type		detection (answer-back of contact input),
and method (zero-span calibration, zero		(14) Calibration coefficient alarm, (15)
calibration only, span calibration only),		Startup power stabilization timeout alarm
stabilization time (min. sec), calibration		Contact output 4 is set to normally
time (min. sec), calibration interval (day/		operated, and fixed error status.
hour), starting time (year/month/day,		but: Two points, voltage-free contacts.
hour/minute)		The following functions are programmable
Equipment Related Items: Measuring gas selection		for contact inputs:
Output Related Items: Analog output/output mode		(1) Calibration gas pressure decrease
selection, output conditions when		alarm, (2) Range switching, (3) External
warming-up/maintenance/calibrating		calibration start, (4) Process alarm (if this
(during blowback)/abnormal, oxygen		signal is received, the heater power turns
concentration at 4 mA/20 mA (vol%		off), (5) Blowback start
$O_2$ ), time constant.		pacity: Off-state leakage current; 3 mA or
Alarm Related Items: Oxygen concentration high		less
alarm/ high-high alarm limit values (vol%		sis: Abnormal cell, abnormal cell
O <sub>2</sub> ), oxygen concentration low alarm/		temperature (low/high), abnormal
low-low alarm limit values (vol% $O_2$ ),		calibration, defective A/D converter,
oxygen concentration alarm hysteresis		defective digital circuit
$(vol\% O_2)$ , oxygen concentration alarm		Method; Zero/span calibration
detection, alarm delay (seconds)	Calibratio	n mode; automatic, semi-automatic and
Contact Related Items: Selection of contact input 1		manual (All are operated interactively
and 2, selection of contact output 1 to 4		with an LCD touchscreen). Either zero
(abnormal, high-high alarm, high alarm,		or span can be skipped.
low alarm, low-low alarm, maintenance,	Zero calib	pration gas concentration setting range;
calibrating, range switching,		0.3 to 100 vol% $O_2$ (minimum setting:
warming-up,		0.01 vol% O <sub>2</sub> ).
calibration gas pressure decrease,	Span calil	bration gas concentration setting range;
temperature high alarm, blowback,		4.5 to 100 vol% $O_2$ (minimum setting :
fl ameout gas detection, calibration		0.01 vol% O <sub>2</sub> ).
coefficient alarm, stabilization timeout.)		Use N <sub>2</sub> -balanced mixed gas containing
Converter Output: Two points mA analog output (4		0 to 10% scale of oxygen, and 80 to 100
to20 mA DC (maximum load resistance		% scale of oxygen for standard zero gas
of 550 $\Omega$ )) and one of two mA outputs		and standard span gas respectively.
is with digital output (HART) (minimum	Calibratio	n interval; date/time setting:
load resistance of 250 $\Omega$ ).		maximum 255 days

#### Wetted Material: SUS316 (JIS), Zirconia, SUS304 (JIS) or ASTM grade 304 (flange),

mist are removed.)

Hastelloy B, (Inconel 600, 601) Construction: Heater and thermocouple replaceable construction. Non explosion proof JIS C0920 / equivalent to IP44D. Equivalent to NEMA 4X/IP66 (Achieved when the cable entry is completely sealed with a cable gland in the recirculation pressure compensated version.)

3. ZR202G Integrated type Zirconia Oxygen

Can be operated in the field without opening the cover

Output Signal: 4 to 20 mA DC, one point (maximum

Contact Output Signal: Two points (one is fail-safe,

depending on number of field devices connected to the loop (multi-drop mode).

It is necessary to mount the cell using

inconel cell-bolts when the temperature is

High temperature service - greater than

pressure in the furnace exceeds 3 kPa, it is recommended to use pressure

compensated type. When the pressure

in the furnace exceeds 5 kPa, pressure

No pressure fluctuation in the furnace

compensated type is required.)

a check valve and the ZA8F Flow Setting Unit,

kPa. When with a check valve and the ZR20H

Automatic Calibration Unit, it is 200 kPa. If the

Ambient Temperature: -20 to +55°C (- 5 to +70°C on

Ambient Humidity: 0 to 95 %RH (non-condensing)

Power Supply Voltage: Ratings; 100 to 240 V AC

Power Supply Frequency: Ratings; 50/60 Hz

Reference Gas System: Natural Convection.

Acceptable range; 85 to 264 V AC

Instrument Air, or Pressure Compensated

inside the furnace (It is recommended to

use air which is dehumidified by cooling

to dew point -20°C or less, and dust or oil

Pressure; 200 kPa plus the pressure

Acceptable range; 45 to 66 Hz

Power Consumption: Max. 300 W, approx. 100 W for

Instrument Air System (excluding Natural Convection):

Consumption; Approx. 1 NI/min

pressure of your sample gas exceeds these limits,

the maximum pressure of sample gas is 150

load resistance 550 Ω)

Digital Communication (HART): 250 to  $550 \Omega$ ,

normally open)

Sample Gas Temperature: 0 to 700°C

greater than 600°C.

should be allowed.

consult with Yokogawa.

Storage Temperature: -30 to +70°C

ordinary use.

Note: When the detector is used in conjunction with

Probe Length: 0.4, 0.7, 1.0, 1.5, 2.0, 2.5, 3.0 m

Probe Material: JIS SUS316 stainless steel

the case surface)

700°C - is not available. Sample Gas Pressure: - 5 to + 250 kPa (When the

Contact Input Signal: Two points

Analyzer

**Oxvgen Analvzer** 

using optical switches.

Display: 6-digit LCD

Switch: Three optical switches

#### Gas Connection: Rc1/4 or 1/4 NPT(Female) Wiring Connection: G1/2, Pg 13.5, M20 × 1.5, 1/2 NPT select one type (4 pieces) Installation: Flange mounting Probe Mounting Angle: Horizontal to vertically downward. When the probe insertion length is 2 m or less, installing at angles from horizontal to vertical downward is available. When the probe insertion length is 2.5 m or more, mount vertically downward (within $\pm$ 5°) and use a probe protector. Case: Aluminum allov Paint Color:Cover; Mint green (Munsell 5.6BG3.3/2.9) Case; Mint green (Munsell 5.6BG3.3/2.9) Polyurethane corrosion-resistance coating Finish: Weight: Insertion length of 0.4 m: approx. 8 kg (JIS 5K 65) / approx. 13 kg (ANSI 150 4) Insertion length of 1.0 m: approx. 10 kg (JIS 5K 65) / approx. 15 kg (ANSI 150 4) Insertion length of 1.5 m: approx. 12 kg (JIS 5K 65) / approx. 17 kg (ANSI 150 4) Insertion length of 2.0 m: approx. 14 kg (JIS 5K 65)

- / approx. 19 kg (ANSI 150 4) Insertion length of 3.0 m: approx. 17 kg (JIS 5K 65)
  - / approx. 22 kg (ANSI 150 4)

#### Functions

- Display Function: Displays values of the measured oxygen concentration, etc. Alarm, Error Display: Displays alarms such as "AL-
- 06" or errors such as "Err -01" when any such status occurs.
- Calibration Functions: Automatic Calibration; Requires the ZR20H Automatic Calibration Unit. It calibrates automatically at specified intervals.
- Semi-automatic Calibration; Requires the ZR20H Automatic Calibration Unit. Input calibration start signal by optical switch or contact, then it calibrates automatically afterwards.
- Manual Calibration; Calibration with opening/closing the valve of calibration gas in operation interactively with the optical switch.
- Maintenance Functions: Can operate updated data settings in daily operation and checking. Display data settings, calibration data settings, test settings (current output loop check, input/ output contact check).
- Setup Functions:
  - Initial settings suit for the plant conditions when installing the converter. Current output data settings, alarm data settings, contact data settings, other settings.

Display and setting content:

- Display Related Items: Oxygen concentration (vol% O<sub>2</sub>), output current value (mA), air ratio, moisture quantity (in hot gases) (vol% H<sub>2</sub>O), Cell temperature (°C ), thermocouple reference junction temperature (°C ), maximum/minimum/ average oxygen concentration (vol% O<sub>2</sub>), cell e.m.f. (mV), cell internal resistance (Ω), cell condition (in four grades), heater on-time rate (%), calibration record (ten times), time (year/ month/day/hour/minute)
- Calibration Setting Items: Span gas concentration  $(vol\% O_2)$ , zero gas concentration  $(vol\% O_2)$ , calibration mode (automatic, semiautomatic, manual), calibration type and method (zero-span calibration, zero calibration only, span calibration only), stabilization time (min.sec), calibration time (min.sec), calibration interval (day/ hour), starting time (year/month/day/ hour/minute)
- Output Related Items: Analog output/output mode selection, output conditions when warming- up/maintenance/calibrating/ abnormal, oxygen concentration at 4 mA/20 mA (vol% O<sub>2</sub>), time constant, preset values when warming-up/ maintenance/calibrating/abnormal, output preset values on abnormal
- Alarm Related Items: Oxygen concentration high alarm/ high-high alarm limit values (vol% O<sub>2</sub>), oxygen concentration low alarm/ low-low alarm limit values (vol% O<sub>2</sub>), oxygen concentration alarm hysteresis (vol% O<sub>2</sub>), oxygen concentration alarm detection, alarm delay (seconds)
- Contact Related Items: Selection of contact input 1 and 2, selection of contact output 1 and 2 (abnormal, high-high alarm, high alarm, low alarm, low-low alarm, maintenance, calibrating, range switching, warming-up, calibration gas pressure decrease, flameout gas detection (answer-back of contact input)
- Converter Output: One mA analog output point (4 to 20 mA DC (maximum load resistance of 550  $\Omega$ )) with mA digital output point (HART) (minimum load resistance of 250  $\Omega$ ).
- Range: Any setting between 0 to 5 through 0 to 100 vol% O<sub>2</sub> in 1 vol% O<sub>2</sub>, and partial range is available (Maximum range value/ minimum range value 1.3 or more)
  For the log output, the minimum range value is fixed at 0.1 vol% O<sub>2</sub>.
  4 to 20 mA DC linear or log can be selected. Input/output isolation.

Output damping; 0 to 255 seconds. Hold/non-hold selection, preset value setting possible with hold.

- Contact Output: Two points, contact capacity 30 V DC 3 A, 250 V AC 3 A (resistive load) One of the output points can be selected to ether normally energized or normally de-energized status. Delayed functions (0 to 255 seconds) and hysteresis function (0 to 9.9 vol%  $O_2$ ) can be added to high/low alarms. The following functions are programmable for contact outputs. (1) Abnormal, (2) High-high alarm,
   (3) High alarm, (4) Low-low alarm, (5) Low alarm, (6) Maintenance, (7) Calibration, (8) Range switching answer-back, (9) Warmup, (10) Calibration-gas pressure decrease (answer-back of contact input), (11) Flameout gas detection (answer-back of contact input). Contact Input: Two points, voltage-free contacts The following functions are programmable for contact inputs. (1) Calibration gas pressure decrease alarm, (2) Range switching (switched range is fixed), (3) External calibration start, (4) Process alarm (if this signal is received, the heater power turns off) Self-diagnosis: Abnormal cell, abnormal cell temperature (low/high), abnormal calibration, defective A/D converter, defective digital circuit Calibration: Method; Zero/span calibration
- Calibration mode; Automatic, semi-automatic and manual (All are operated using optical switches). Either zero or span can be skipped.
- Zero calibration gas concentration setting range; 0.3 to 100 vol%  $O_2$  (minimum setting: 0.01 vol%  $O_2$ ).
- Span calibration gas concentration setting range; 4.5 to 100 vol% O<sub>2</sub> (minimum setting: 0.01 vol% O<sub>2</sub>). Use N<sub>2</sub>-balanced mixed gas containing 0
  - to10% scale of oxygen for standard zero gas, and 80 to 100% scale of oxygen for standard span gas.
- Calibration interval; date/time setting: maximum 255 days

# STANDARD SPECIFICATIONS (High Temperature Humidity Analyzer)

#### **Examples of Application**

Separate/Integrated type Zirconia High Temperature Humidity Analyzer

- · Coloring processes in the textile industry
- Steam curing processes for concrete products
- Manufacturing processes in the cigarette, food, paper or pulp industries
- Drying processes in various manufacturing of building materials, lumber, plasterboard, food or the like
- Humidifying processes in various manufacturing of food or the like

Please contact us for other applications.

#### **General Specifications**

#### High Temperature Humidity Analyzer

Oxygen concentration in mixed gas which consists of water vapor and air is proportional to the volumetric ratio of oxygen in the air, so the volumetric ratio of water vapor can be calculated from the oxygen concentration.

Measurement Object: Water vapor (in vol%) in mixed gases (air and water vapor) Measurement System: Zirconia system

Measurement Range: 0.01 to 100 vol% O $_{\rm 2}$  ,0 to 100 vol% H $_{\rm 2}O$  or 0 to 1.000 kg/kg

- Output Signal: 4 to 20 mA DC (maximum load resistance 550  $\Omega$ )
- Setting Range: Any setting in the range of 0 to 5 through 0 to 100 vol%  $O_2$  (in 1 vol%  $O_2$ ), or partial range. Moisture quantity; 0 to 25 through 0 to

100 vol%  $H_2O$  (in 1 vol%  $H_2O$ ), or partial range.

Mixture ratio; 0 to 0.2 through 0 to 1.000 kg/kg (in 0.001 kg/kg), or partial range. Digital Communication (HART): 250 to 550  $\Omega$ , depending on number of field devices

- connected to the loop (multi-drop mode). Display Range: Oxygen concentration; 0 to 100 vol%
  - O<sub>2</sub> , Moisture quantity; 0 to 100 vol% H<sub>2</sub>O Mixture ratio; 0 to 1 kg/kg Relative humidity; 0 to 100% RH (Note) Dew point; -40 to 370°C (Note)
- Note: These values are affected by temperature and absolute pressure, So accurate temperature and pressure values must be inputted to the converter.

Warm-up Time: Approx. 20 min.

These characteristics are calculated by oxygen concentration measured in air which include water vapor.

Repeatability: (see Note 1)

 $\pm$  1 vol% H<sub>2</sub>O; (Sample gas pressure 2 kPa or less)

Linearity: (Excluding standard gas tolerance) (see Note 1), (Use oxygen of known concentration (in the measuring range) as the zero and span calibration gas.) ± 2 vol% H<sub>2</sub>O; (Sample gas pressure: within ± 0.49 kPa) ± 3 vol% H<sub>2</sub>O; (Sample gas pressure: 2 kPa or less) Drift: (Excluding the first two weeks in use)

(see Note 1) Both zero and span  $\pm$  3 vol% H<sub>2</sub>O/month

- Response Time: Response of 90% within 5 seconds. (Measured after gas is introduced from calibration gas inlet and analog output starts changing.)
- (Note 1) These tolerances do not apply to the pressure compensated version, or where natural convection is used for the reference gas.
- Safety, EMC and RoHS conformity standards for the ZR402G and ZR202G
- Installation altitude based on IEC 61010: 2000 m or less
- Category based on IEC 61010: II (Note)
- Pollution degree based on IEC 61010: 2 (Note) Note: Installation category, called over-voltage category, specifies impulse withstand voltage. Category II is for electrical equipment. Pollution degree indicates the degree of existence of solid, liquid, gas or other inclusions which may reduce dielectric strength. Degree 2 is the normal indoor environment.
- Safety: EN 61010-1, EN 61010-2-030, CAN/CSA-C22.2 No. 61010-1, UL Std. No. 61010-1
- EMC: EN 61326-1 Class A, Table 2 (For use in industrial locations) EN 61326-2-3, EN 61000-3-2 EMC Regulatory Arrangement in Australia and New Zealand Korea Electromagnetic Conformity Standard

Note: This instrument is a Class A product, and it is designed for use in the industrial environment. Please use this instrument in the industrial environment only. RoHS: EN 50581

#### 1. ZR22G Separate type Zirconia High Temperature Humidity Analyzer,Detector

### High Temperature Humidity Analyzer

Sample Gas Temperature: 0 to 700°C (Probe only) It is recommended to mount the cell using inconel cell-bolts when the temperature is greater than 600°C.

Sample Gas Pressure: - 5 to + 20 kPa (When the pressure in the furnace exceeds 3 kPa, it is recommended to use pressure compensated type. When the pressure in the furnace exceeds 5 kPa, pressure compensated type is required.) No pressure fluctuation in the process should be allowed.

Probe Length: 0.4, 0.7, 1.0, 1.5, 2.0, 2.5, 3.0 m Probe Material: JIS SUS316 stainless steel Ambient Temperature: -20 to +150°C

Reference Gas System: Natural Convection, Instrument Air,or Pressure compensated

- Instrument Air System (excluding Natural Convection): Pressure; 200 kPa plus the pressure inside the furnace. (It is recommended to use air which has been dehumidified by cooling to dew point - 20°C or less, and dust or oil mist are removed.) Consumption; Approx. 1 NI/min
- Wetted Material: SUS316 (JIS), Zirconia, SUS304 (JIS) or ASTM grade 304 (flange), Hastelloy B, (Inconel 600, 601)

- Construction: Heater and thermocouple replaceable construction. Non explosion proof JIS C0920 / equivalent to IP44D. Equivalent to NEMA 4X/IP66 (Achieved when the cable entry is completely sealed with a cable gland in the recirculation pressure compensated version.) Terminal Box Case: Material; Aluminum alloy
- Terminal Box Case. Material, Adminum alloy Terminal Box Paint Color: Case; Mint green (Munsell 5.6BG3.3/2.9)

Cover; Mint green (Munsell 5.6BG3.3/2.9) Gas Connection: Rc1/4 or 1/4 NPT (Female)

- Wiring Connection: G1/2, Pg 13.5,  $M20 \times 1.5$ ,
- 1/2 NPT
- Installation: Flange mounting

Probe Mounting Angle: Horizontal to vertically downward. When the probe insertion length is 2 m or less, installing at angles from horizontal to vertically downward is available.

When the probe insertion length exceeds 2.5 m, mount vertically downward (within  $\pm 5^{\circ}$ ) and use a probe protector.

#### Weight:

- Insertion length of 0.4 m: approx. 6 kg (JIS 5K 65) / approx. 11 kg (ANSI 150 4)
- Insertion length of 1.0 m: approx. 8 kg (JIS 5K 65) / approx. 13 kg (ANSI 150 4)
- Insertion length of 1.5 m. approx. 10 kg (JIS 5K 65) / approx. 15 kg (ANSI 150 4)
- Insertion length of 2.0 m: approx. 12 kg (JIS 5K 65) / approx. 17 kg (ANSI 150 4)
- Insertion length of 3.0 m: approx. 15 kg (JIS 5K 65) / approx. 20 kg (ANSI 150 4)

#### 2. ZR402G Separate type Zirconia High Temperature Humidity Analyzer, Converter

#### High Temperature Humidity Analyzer

Operated using an LCD touchscreen on the converter. Display: LCD display of size 320 by 240 dot with touchscreen. Output Signal: 4 to 20 mA DC, two points (maximum load resistance 550  $\Omega$  ) Contact Output Signal: Four points (one is fail-safe, normally open) Contact Input: Two points Analog Input: One point (thermal input 4-20 mA) Automatic Calibration Output: Two points (for dedicated automatic calibration unit) Ambient Temperature: -20 to +55°C Storage Temperature: -30 to +70°C Ambient Humidity: 0 to 95 %RH (non-condensing) Power Supply Voltage: Ratings; 100 to 240 V AC Acceptable range; 85 to 264 V AC Power Supply Frequency: Ratings; 50/60 Hz Acceptable range; 45 to 66 Hz Power Consumption: Max. 300 W, approx. 100 W for ordinary use. Maximum Distance between Detector and Converter: Conductor two-way resistance must be 10  $\Omega$  or less (when a 1.25 mm<sup>2</sup> cable or equivalent is used, 300 m or less.) Construction: Outdoor installation, equivalent to NEMA 4X/IP66 (with conduit holes completely sealed with a cable gland)

Wiring Connection: G1/2, Pg 13.5, M20 × 1.5, 1/2<br/>NPT (with plug), eight holesInstallation: Panel, wall or pipe mountingCase:Aluminum alloyPaint Color: Door; Silver gray (Munsell 3.2PB7.4/1.2)<br/>Case; Silver gray (Munsell 3.2PB7.4/1.2)Finish:Polyurethane corrosion-resistance coatingWeight:Approx. 6 kg

### Functions

Display Functions: Value Display; Displays values of the measured

oxygen concentration, moisture quantity,mixture ratio, etc

- Graph Display; Displays trends of measured oxygen concentration, moisture quantity, mixture ratio, etc
- Data Display; Displays various useful data for maintenance, such as cell temperature, reference junction temperature, maximum/ minimum moisture quantity, or the like
- Status Message; Indicates an alarm or error occurrence by flashing of the corresponding icon. Indicates status such as warming-up, calibrating, or the like by the marks.

Alarm, Error Display: Displays alarms such as "Abnormal moisture quantity" or errors such as "Abnormal cell e.m.f." when any such status occurs.

- Calibration Functions:
  - Automatic Calibration; Requires the ZR40H Automatic Calibration Unit. It calibrates automatically at specified intervals.

Semi-automatic Calibration; Requires the ZR40H Automatic Calibration Unit. Input calibration direction on the touchscreen or contact, then it calibrates automatically afterwards.

Manual Calibration; Calibration with opening/closing the valve of calibration gas in operation interactively with an LCD touchscreen.

Blowback Function:

Output through the contact in the set period and time. Auto/Semi\_Auto selectable.

Maintenance Functions:

Can operate updated data settings in daily operation and checking. Display data settings, calibration data settings, blowback data settings, current output loop check, input/output contact check.

Setup Functions:

Initial settings suit for the plant conditions when installing the converter. Equipment settings, current output data settings, alarm data settings, contact data settings, other settings.

Self-diagnosis:

This function diagnoses conditions of the converter or the detector and indicates when any abnormal condition occurs. Password Functions:

Enter your password to operate the analyzer excepting data display. Individual passwords can be set for maintenance and setup. Display and setting content:

- Measuring Related Items: Oxygen concentration (vol% O<sub>2</sub>), moisture quantity (vol% H<sub>2</sub>O), mixture ratio (kg/kg), relative humidity (%RH) and dew point (°C)
- Display Items: Oxygen concentration (vol% O<sub>2</sub>), moisture quantity (vol% H<sub>2</sub>O), mixture ratio (kg/kg), relative humidity (%RH), dew point (°C), cell temperature (°C), thermocouple reference junction temperature (°C), maximum/minimum/ average oxygen concentration (vol% O<sub>2</sub>), maximum/ minimum/average moisture quantity (vol% H<sub>2</sub>O), maximum/ minimum/average mixture ratio (kg/ kg), cell e.m.f. (mV), output 1, 2 current (mA), cell response time (seconds), cell internal resistance ( $\Omega$ ), cell condition (in four grades), heater on-time rate (%), calibration record (ten times), time (year/ month/day, hour/minute)
- Calibration Setting Items: Span gas concentration (vol% O<sub>2</sub>), zero gas concentration (vol% O<sub>2</sub>), calibration mode (automatic, semiautomatic, manual), calibration type and method (zero-span calibration, zero calibration only, span calibration only), stabilization time (min.sec), calibration time (min.sec), calibration interval (day/ hour), starting time (year/month/day, hour/minute)
- Output Related Items: Ánalog output/output mode selection, output conditions when warmingup/maintenance/calibrating/ abnormal, oxygen concentration at 4 mA/20 mA (vol% O<sub>2</sub>), moisture quantity at 4 mA/20 mA (vol% H<sub>2</sub>O), mixture ratio at 4 mA/20 mA (kg/ kg), time constant.
- Alarm Related Items: Oxygen concentration high alarm/ high-high alarm limit values  $(vol \% O_2)$ , oxygen concentration low alarm/low-low alarm limit values (vol% O<sub>2</sub>), moisture quantity high alarm/highhigh alarm limit values (vol% H<sub>2</sub>O), moisture quantity lowalarm/ low-low alarm limit values (vol% H<sub>2</sub>O), mixture ratio high alarm/high-high alarm limit value (kg/ kg), mixture ratio low alarm/ low-low alarm limit values (kg/ kg), oxvgen concentration alarm hysteresis  $(vol\% O_2)$ , moisture quantity alarm hysteresis (vol% H<sub>2</sub>O), mixture ratio alarm hysteresis (kg/ kg), oxygen concentration/moisture quantity/mixture ratio alarm detection, alarm delay (seconds).
- Contact Related Items: Selection of contact input 1 and 2, selection of contact output 1 to 4 (abnormal, high-high alarm, high alarm, low alarm, low-low alarm, maintenance, calibrating, range switching, warmingup, calibration gas pressure decrease, temperature high alarm blowback, flameout gas detector calibration coefficient alarm, stabilization timeout)

- Converter Output: Two points mA analog output (4 to 20 mA DC (maximum load resistance of 550  $\Omega$ )) and one of two mA outputs is with digital output (HART) (minimum load resistance of 250  $\Omega$ ).
- Range: Any setting between 0 to 5 through 0 to 100 vol%  $O_2$ , 0 to 25 through 0 to 100 vol%  $H_2O$ , 0 to 0.200 through 0 to 1.000 kg/ kg or partial range is available. For the log output, the minimum range values are fixed to 0.1 vol%  $O_2$  for the oxygen concentration, 0.1 vol%  $H_2O$  for the misture quantity, and 0.01 kg/kg for the mixture ratio. 4 to 20 mA DC linear or log can be selected. Input/output isolation.
- Output damping: 0 to 255 seconds. Hold/non-hold selection, preset value setting possible with hold.
- Contact Output: Four points, contact capacity 30 V DC 3 A, 250 V AC 3 A (resistive load). Three of the output points can be selected to either normally energized or normally deenergized status. Delayed functions (0 to 255 seconds) and hysteresis function (0 to 9.9 vol%O<sub>2</sub>) can

be added to high/low alarms. The following functions are programmable

for contact outputs. (1) Abnormal, (2) High-high alarm, (3) Highalarm, (4) Low low alarm, (5) Low alarm, (6) Maintenance, (7) Calibration, (8) Range switching answer-back, (9) Warm-up, (10) Calibration gas pressure decrease (answer-back of contact input), (11) Temperature high-alarm, (12) Blowback start, (13) Flameout gas detection (answer-back of contact input), (14) Calibration coefficient alarm, (15) Startup power stabilization timeout alarm Contact output 4 is set to normally operated, and fixed error status.

- Converter Input: Thermal input one point (4 to 20 mA DC)
- Contact Input: Two points, voltage-free contacts The following functions are programmable for contact inputs:

(1) Calibration gas pressure decrease alarm, (2) Range switching - fixed range if use range switching (3) External calibration start, (4) Process alarm (if this signal is received, the heater power turns off), (5) Blowback start

- Contact capacity: Off-state leakage current; 3 mA or less
- Self-diagnosis: Abnormal cell, abnormal cell temperature (low/high), abnormal calibration, defective A/D converter, defective digital circuit
- Calibration: Method; Zero/span calibration Calibration mode; automatic, semi-automatic and manual (All are operated interactively with an LCD touchscreen). Either zero or span can be skipped.
- Zero calibration-gas concentration setting range; 0.3 to 100 vol%  $O_2$  (minimum setting: 0.01 vol%  $O_2$ ).

#### 3. ZR202G Integrated type Zirconia High Temperature Humidity Analyzer

#### High Temperature Humidity Analyzer

Can be operated in the field without opening the cover using optical switches.

Display: 6-digit LCD Three optical switches Switch: Output Signal: 4 to 20 mA DC, one point (maximum load resistance 550  $\Omega$ ) Digital Communication (HART): 250 to 550  $\Omega$ , depending on number of field devices connected to the loop (multi-drop mode). Contact Output Signal: Two points (one is fail-safe, normally open) Contact Input Signal: Two points Sample Gas Temperature: 0 to 700°C It is necessary to mount the cell using inconel cell-bolts when the temperature than 600°C. Sample Gas Pressure: - 5 to + 20 kPa (When the pressure in the furnace exceeds 3 kPa. it is recommended to use pressure compensated type. When the pressure in the furnace exceeds 5 kPa, pressure

compensated type is required.) No pressure fluctuation in the process should be allowed.

- Probe Length: 0.4, 0.7, 1.0, 1.5, 2.0, 2.5, 3.0 m
- Probe Material: JIS SUS316 stainless steel
- Ambient Temperature: -20 to +55°C (- 5 to +70°C on the case surface)

Storage Temperature: -30 to +70°C

- Ambient Humidity: 0 to 95%RH (non condensing)
- Power Supply Voltage: Ratings; 100 to 240 V AC Acceptable range; 85 to 264 V AC
- Power Supply Frequency: Ratings; 50/60 Hz Acceptable range; 45 to 66 Hz
- Power Consumption: Max. 300 W, approx. 100 W for ordinary use.
- Reference Gas System: Natural Convection, Instrument Air, or Pressure Compensated
- Instrument Air System (excluding Natural Convection): Pressure; 200 kPa plus the pressure inside the process (It is recommended to use air which is dehumidified by cooling to dew point -20°C or less, and dust or oil mist are removed.) Consumption; Approx. 1 NI/min
- Wetted Material SUS316 (JIS), Zirconia, SUS304 (JIS) or ASTM grade 304 (flange), Hastelloy B, (Inconel 600, 601)
- Construction: Heater and thermocouple replaceable construction. Non explosion-proof JIS C0920 / equivalent to IP44D. Equivalent to NEMA 4X/IP66 (Achieved when the cable entry is completely sealed with a cable gland in the recirculation pressure compensated version.)

Gas Connection: Rc1/4 or 1/4 NPT (Female) Wiring Connection: G1/2, Pg 13.5, M20 × 1.5, 1/2 NPT select one type (4 pieces) Installation: Flange mounting Probe Mounting Angle: Horizontal to vertically downward. When the probe insertion length is 2 m or less, installing at angles from horizontal to vertically downward is available. When the probe insertion length is 2.5 m or more, mount vertically downward (within ± 5°) and use a probe protector. Case: Aluminum allov Paint Color:Cover; Mint green (Munsell 5.6BG3.3/2.9) Case; Mint green (Munsell 5.6BG3.3/2.9) Finish: Polyurethane corrosion-resistance coating Weight: Insertion length of 0.4 m: approx. 8 kg (JIS 5K 65) / approx. 13 kg (ANSI 150 4) Insertion length of 1.0 m: approx. 10 kg (JIS 5K 65) / approx. 15 kg (ANSI 150 4) Insertion length of 1.5 m: approx. 12 kg (JIS 5K 65) / approx. 17 kg (ANSI 150 4) Insertion length of 2.0 m: approx. 14 kg (JIS 5K 65) / approx. 19 kg (ANSI 150 4) Insertion length of 3.0 m: approx. 17 kg (JIS 5K 65) / approx. 22 kg (ANSI 150 4)

#### Functions

Display Function: Displays values of the measured oxygen concentration, moisture quantity, mixture ratio etc

Alarm, Error Display: Displays alarms such as "AL-06" or errors such as "Err-01" when any such status occurs.

Calibration Functions: Automatic Calibration; Requires the ZR20H

Automatic Calibration Unit. It calibrates automatically at specified intervals. Semi-automatic Calibration: Requires the ZR20H

Semi-automatic Calibration; Requires the ZR20H Automatic Calibration Unit. Input calibration start signal by optical switch or contact, then it calibrates automatically afterwards.

Manual Calibration; Calibration with opening/closing the valve of calibration gas in operation interactively with the optical switch.

- Maintenance Functions: Can operate updated data settings in daily operation and checking. Display data settings, calibration data settings, test settings (current output loop check, input/ output contact check).
- Setup Functions:
  - Initial settings suit for the plant conditions when installing the converter. Current output data settings, alarm data settings, contact data settings, other settings.

Display and setting content:

- Display Related Items: Oxygen concentration  $(vol\% O_2)$ , moisture quantity (vol%)H<sub>2</sub>O), mixture ratio(kg/kg), relative humidity(%RH), dew point (°C), cell temperature (°C), thermocouple reference junction temperature (°C), maximum/minimum/average oxygen concentration (vol% O2), maximum/ minimum/average moisture quantity (vol% H<sub>2</sub>O), maximum/minimum/average mixture ratio (kg/kg), cell e.m.f. (mV), output 1, 2 current (mA), cell response time (seconds), cell internal resistance  $(\Omega)$ , cell condition (in four grades), heater on-time rate (%), calibration record (ten times), time (year/month/ day/hour/minute)
- Calibration Setting Items: Span gas concentration (vol%  $O_2$ ), zero gas concentration (vol%  $O_2$ ), calibration mode (automatic, semi-automatic, manual), calibration type and method (zero-span calibration, zero calibration only, span calibration only), stabilization time (min.sec), calibration time (min.sec), calibration time (mort, starting time (year/month/day/hour), starting time (year/month/day/hour/minute)
- Output Related Items: Analog output/output mode selection, output conditions when warming-up/ maintenance/calibrating/ abnormal, oxygen concentration at 4 mA/ 20 mA (vol% O<sub>2</sub>), moisture quantity at 4 mA/ 20 mA (vol% H<sub>2</sub>O), mixture ratio at 4 mA/ 20 mA (kg/kg), time constant, preset values when warmingup/maintenance/calibrating/abnormal, output preset values on abnormal
- Alarm Related Items: Oxygen concentration high alarm/ high-high alarm limit values (vol% O<sub>2</sub>), oxygen concentration low alarm/low-low alarm limit values (vol% O<sub>2</sub>), moisture quantity high alarm/ high-high alarm limit values (vol% H<sub>2</sub>O), moisture quantity low alarm/ low-low alarm limit values (vol% H<sub>2</sub>O), mixture ratio high alarm/high-high alarm limit values (kg/kg), mixture ratio low alarm/low-low alarm limit values (kg/kg), oxygen concentration alarm hysteresis (vol% O<sub>2</sub>), moisture quantity alarm hysteresis (vol% H<sub>2</sub>O), mixture ratio alarm hysteresis (kg/kg), oxygen concentration/moisture quantity/ mixture ratio detection, alarm delay (seconds)

Contact Related Items: Selection of contact input 1 and 2, selection of contact output 1 and 2 (abnormal, high-high alarm, high alarm, low alarm, low-low alarm, maintenance, calibrating, range switching, warming-up, calibration gas pressure decrease, flameout gas detection

- $\begin{array}{l} \mbox{Converter Output: One mA analog output point (4 \\ to 20 mA DC (maximum load resistance \\ of 550 \ \Omega \ )) with mA digital output point \\ (HART) (minimum load resistance of 250 \\ \Omega \ ). \end{array}$
- Range; Any setting between 0 to 25 through 0 to 100 vol% H<sub>2</sub>O, and partial range is available (Maximum range value/minimum range value 1.3 or more) For the log output, the minimum range values are fixed to 0.1 vol% O<sub>2</sub> for the oxygen concentration, 0.1 vol% H<sub>2</sub>O for the moisture quantity, and 0.01 kg/kg for the mixture ratio.
  4 to 20 mA DC linear or log can be
- selected. Input/output isolation Output damping; 0 to 255 seconds. Hold/non-hold selection, preset value setting possible with hold.
- Contact Output: Two points, contact capacity 30 V DC 3 A, 250 V AC 3 A (resistive load) Normally energized or normally deenergized can be selected. Delayed functions (0 to 255 seconds) and hysteresis function (0 to 9.9 vol% O<sub>2</sub>) can be added to high/low alarms. The following functions are programmable for contact outputs.
  - (1) Abnormal, (2) High-high alarm,
  - (3) Highalarm, (4) Low-low alarm,
  - (5) Low alarm, (6) Maintenance,
  - (7) Calibration, (8) Range switching answer-back, (9) Warm-up,
  - (10) Calibration gas pressure decrease (answer-back of contact input),
  - (11) Flameout gas detection (answer-back of contact input).
- Contact Input: Two points, voltage-free contacts The following functions are programmable for contact inputs.
  - (1) Calibration-gas pressure decrease alarm, (2) Range switching (switched range is fixed), (3) External calibration start, (4) Process alarm (if this signal is received, the heater power turns off)
- Contact capacity: Off-leakage current; 3 mA or less.
- Self-diagnosis: Abnormal cell, abnormal cell temperature (low/high), abnormal calibration, defective A/D converter, defective digital circuit
- Calibration: Method; Zero/span calibration Calibration mode; automatic, semi-automatic and manual (All are operated using optical switches). Either zero or span can be skipped.
- Zero calibration gas concentration setting range; 0.3 to 100 vol%  $O_2$  (minimum setting: 0.01 vol%  $O_2$ ).
- Span calibration gas concentration setting range; 4.5 to 100 vol% O<sub>2</sub> (minimum setting: 0.01 vol% O<sub>2</sub>).

Use  $N_2$ -balanced mixed gas containing 0 to 10% scale of oxygen for standard zero gas, and 80 to 100% scale of oxygen for standard span gas.

Calibration interval; date/time setting: maximum 255 days

# OPTIONS

#### 4. ZO21P-H High Temperature Probe Adapter for separate type Oxygen Analyzer

Measuring O<sub>2</sub> in the high temperature gases (exceeds 700°C) requires a general-use probe ZR22G of 0.15 m length and a high temperature probe adapter.

Sample gas temperature: 0 to 1400°C (when using SiC probe)

0 to 800°C (when using SUS310S probe adapter)

- Sample gas pressure: -0.5 to + 5 kPa. When using in the range of 0 to 25 vol%  $O_2$  or more, the sample gas pressure should be in the range of -0.5 to +0.5 kPa. (Where the sample gas pressure for the hightemperature probe is negative, an ejector
- assembly is necessary.) Insertion length: 0.5, 0.6, 0.7, 0.8, 0.9, 1.0, 1.5 m Material in Contact with Gas: SUS316 (JIS), SiC or SUS310S, SUS304 (JIS) or ASTM grade
- 304 (flange) Probe Material: SiC, SUS310S (JIS)
- Installation: Flange mounting (FF type or RF type)
- Probe Mounting Angle: Vertically downward within ±
  - 5°. Where the probe material is SUS310S, horizontal mounting is available.
- Construction: Non explosion-proof. Rainproof construction
- Weight(example): Insertion length of 1.0 m: approx. 5.3 kg (JIS) / approx. 11.3 kg (ANSI) Insertion length of 1.5 m: approx. 5.8 kg (JIS) / approx. 11.8 kg (ANSI)

#### 5. E7046EC/E7046EN Ejector Assembly for High Temperature Detector of separate type Oxygen Analyzer

For use in cases where pressure of sample gas for high temperature detector is negative.

#### 5.1 Needle Valve

Connection: Rc1/4 or 1/4 NPT (Female) Material: SUS316 (JIS) (Note) Pipes and connectors are not provided.

#### 5.2 Pressure Gauge Assembly

Material in Contact with Gas: SUS316 (JIS) Case Material: Aluminum alloy (Paint color; black) Scale: 0 to 100 kPa G Connection: R1/4 or 1/4 NPT. SUS304 (JIS) (with Bushing G3/8 x R1/4 or 1/4 NPT (Female))

5.3 Ejector

Ejector Inlet Air Pressure: 29 to 68 kPa G Air Consumption: Approx. 30 to 40 l/min Suction gas flow rate: 3 to 7 l/min Connection: Rc1/4, SUS304 (JIS) Tube Connection: (ø6/ø4 mm or 1/4 inch copper tube or stainless tube)

#### 6. ZO21R Probe Protector for Zirconia **Oxygen Analyzer**

Used when sample gas flow velocity is approx. 10m/ sec or more and dust particles wears the detector in cases such as pulverized coal boiler of fluidized bed furnace (or burner) to protect the detector from wearing by dust particles. When probe insertion length is 2.5 m or more and horizontal installation, specify the ZO21R-L-200-□\*B to reinforce the probe.

Insertion Length: 1.05, 1.55, 2.05 m.

- Flange: JIS 5K 65A FF equivalent. ANSI Class 150 4 FF (without serration) equivalent. However, flange thickness is different. SUS316 (JIS), SUS304 (JIS) or ASTM Material:
- grade 304 (Flange) Weight: 1.05 m; Approx. 6/10/8.5 kg (JIS/ANSI), 1.55
- m; Approx. 9/13/11.5 kg (JIS/ANSI), 2.05 m; Approx. 12/16/14.5 kg (JIS/ANSI)
- Installation: Bolts, nuts, and washers are provided for detector, probe adapter and process-side flange.

# 7. K9471UA Dust Filter for Oxygen Analyzer

This filter is used to protect the cell from corrosive dust components or high velocity dust in recovery boilers and cement kiln. Sample gas flow rate is needed to be 1m/sec or more to replace gas inside zirconia sensor.

Mesh:	30 microns
Material:	SiC (Filter), SUS316 (JIS)
Weight:	Approx. 0.2 kg

#### 8. K9471UC Dust Guard Protector

Recommended to be used when sample gas is likely to flow directly into the cell due to its flow direction in the stack or the like, flammable dust may go into the cell, or water drops are likely to fall and remain in the cell during downtime or the like due to the installation position.

SUS316 (JIS) Material: Approx. 0.3 kg Weight:

#### **ZH21B Dust Protector for High** 9 temperature Humidity Analyzer

This protector is designed to protect the probe output from dust agitation (i.e., to prevent combustible materials from entering the probe cell) where humidity measurements are made under dusty environments.

Insertion length: 0.440 m

- Flange: JIS 5K 80 FF equivalent or ANSI Class150 4 FF equivalent. (However, flange thickness is different.)
- SiC, SUS316 (JIS), SUS304 (JIS) or Material: ASTM grade 304 (flange)
- Approx. 6 kg (JIS), approx. 8.5 kg (ANSI) Weight: Mounting: Mounted on the probe or process flange withbolts and the associated nuts and washers.

### 10. ZO21S Standard Gas Unit

The ZO21S does not conform to CE marking.

Function: Portable unit for calibration gas supply consisting of span gas (air) pump, zero gas cylinder with sealed inlet, flow rate checker and flow rate needle valve.

Sealed Zero Gas Cylinders (6 provided): E7050BA Capacity: 11

Filled pressure: Approx. 686 kPa G (at 35°C)

- Composition: 0.95 to 1.0 vol% O2 (N2-balanced)
- Power Supply: 100, 110, 115, 200, 220, 240V AC ± 10%, 50/60 Hz

Power Consumption: Max. 5 VA

Paint Color:

Mainframe; Munsell 2.0 GY3.1/0.5 equivalent Munsell 2.8 GY6.4/0.9 equivalent Cover; Weight: Approx. 3 kg

### 11. ZA8F Flow Setting Unit

Used when instrument air is provided.

This unit consists of flowmeter and flow control valve to controls flow rates of calibration gas and reference gas.

Flowmeter Scale: Calibration gas; 0.1 to 1.0 l/min. Reference gas; 0.1 to 1.0 l/min. Construction: Dust-proof and rainproof construction Case Material: SPCC (Cold rolled steel sheet) Painting: Baked epoxy resin, Dark-green (Munsell 2.0

GY 3.1/0.5 or equivalent)

Tube Connections: Rc1/4 or 1/4 NPT (Female) Reference Gas Pressure: Clean air supply of sample gas pressure plus approx. 50 kPa G (or sample gas pressure plus approx.150 kPa when a check valve is used.) Pressure at inlet of the flow setting unit. (Max. 300 kPa G)

Air Consumption: Approx. 1.5 l/min Weight: Approx. 2.3 kg

# 12. ZR40H Automatic Calibration Unit (for Separate type)

Used when automatic calibration is required for the separate type and instrument air is provided. The solenoid valves are provided as standard.

- Construction: Dust-proof and rainproof construction: NEMA 4X/IP67 - only for case coating solenoid valve, not flowmeter (excluding flowmeter)
- Mounting: 2-inch pipe or wall mounting, no vibration Materials: Body: Aluminum alloy, Piping: SUS316 (JIS), SUS304 (JIS), Flowmeter: MA (Methacrylate resin) Bracket : SUS304 (JIS)
- Finish: Polyurethane corrosion-resistance coating, Mint green (Munsell 5.6BG3.3/2.9)

Piping Connection: Rc1/4 or 1/4 NPT (Female)

Power Supply: 24V DC (from ZR402G), Power consumption: Approx. 1.3 W

- Reference Gas Pressure: Sample gas pressure plus Approx. 150 kPa (690 kPa max.), (Pressure at inlet of automatic calibration unit)
- Air Consumption: Approx. 1.5 I/min

Weight: Approx. 3.5 kg

Ambient Temperature: -20 to +55°C, no condensing and freezing Ambient Humidity: 0 to 95%RH

Storage Temperature: -30 to +65°C

# 13. ZR20H Automatic Calibration Unit (for Integrated type)

Used when automatic calibration is specified for the integrated type and instrument air is provided.

Equipped with the analyzer when automatic calibration is specified in the suffix code of the ZR202G Integrated type by selecting either "-A (Horizontal mounting)" or "-B (Vertical mounting)". The ZR20H should be arranged when automatic calibration is to be required after the ZR202H has been installed. Ask Yokogawa service station for its mounting.

Construction: Dust-proof and rainproof construction; NEMA 4X/IP67 (excluding flowmeter) Mounting: Mounted on ZR202G, no vibration

- Materials: Body: Aluminum alloy, Piping: SUS316 (JIS), SUS304 (JIS), Flowmeter: MA (Methacrylate resin)
- Finish: Polyurethane corrosion-resistance coating Case: Mint green (Munsell 5.6BG3.3/2.9),
  - Cover: Mint green (Munsell 5.6BG3.3/2.9), Mint green (Munsell 5.6BG3.3/2.9)
- Piping Connection: Rc1/4 or 1/4 NPT(Female)
- Power Supply: 24V DC (from ZR202G), Power consumption: 1.3 W
- Reference Gas Pressure: Sample gas pressure plus Approx. 150 kPa (690 kPa max.), (Pressure at inlet of automatic calibration unit)

Air Consumption: Approx. 1.5 l/min

Weight: Approx. 2 kg Ambient Temperature: -20 to +55°C, no condensing and freezing

Ambient Humidity: 0 to 95%RH

Storage Temperature: -30 to +65°C

#### 14. L9852CB/G7016XH Stop Valve

The stop valve is mounted on the calibration gas line. It is attached when the suffix code (/SV) is selected for the Zirconia Oxygen Analyzer/High Temperature Humidity Analyzer prove ZR22G or the Zirconia Oxygen Analyzer/High Temperature Humidity Analyzer ZR202G.

Connection: Rc1/4 or 1/4 NPT (Female) Material: SUS316 (JIS) Weight: Approx. 150 g

#### 15. K9292DN/K9292DS Check Valve

This is used to prevent entry of sample gas into calibration gas line. Purpose is the same as stop valve, but is convenient, as it does not need to be opened or closed for calibration.

Mount directly on calibration gas inlet of detector in place of stop valve. However as source pressure of 150 kPa G or more is needed, standard gas unit cannot be used.

When option code "/CV" of the ZR22G or the ZR202G is specified, check valve is provided.

Connection: Rc1/4 or 1/4 NPT (Female)

- Material: SUS304 (JIS)
- Pressure: Between 70 kPa G or more 350 kPa G or less

Weight: Approx. 90 g

#### 16. Air Set

#### G7003XF/K9473XK

Primary Pressure: Max. 1 MPa G Secondary Pressure: 0.02 to 0.2 MPa G Connection: Rc1/4 or 1/4 NPT (F) with joint adapter

#### G7004XF/K9473XG

Primary Pressure: Max. 1 MPa G Secondary Pressure: 0.02 to 0.5 MPa G Connection: Rc1/4 or 1/4 NPT (F) with joint adapter

#### 17. G7001ZC Zero Gas Cylinder

Capacity: 3.4 I

Filled pressure: 9.8 to 12 MPa G Composition: 0.95 to 1.0 vol% O<sub>2</sub> (N<sub>2</sub>-balanced) (Note) Export of such high pressure filled gas cylinders to most countries is prohibited or restricted.

#### 18. G7013XF/G7014XF Pressure Regulator for Gas Cylinder

Primary Pressure: Max.14.8 MPa G, Secondary Pressure; 0 to 0.4 MPa G Connection: Inlet W22 14 threads, right hand screw Outlet Rc1/4 or 1/4 NPT (Female) Material: Brass body

#### 19. E7044KF Case Assembly of Calibration Gas Cylinder

Case Paint: Baked epoxy resin, Jade green (Munsell 7.5 BG 4/1.5) Installation: 2B pipe mounting Approx. 10 kg Weight: (Note) Export of such high pressure filled gas cylinders to most countries is prohibited or restricted.

#### 20. ZR22A, ZR202A Heater Assembly

ZR22A: Spare Parts for ZR22G ZR202A: Spare Parts for ZR202G (Note) Yokogawa shall not guarantee the heater assembly after its replacement.

#### STANDARD ACCESSARIES

ZR402G

ltem	Parts. No.	Q'ty	Description
Fuse	A1113EF	1	3.15 A
Bracket	F9554AL	1	For pipe, panel,or wall mounting
Screws for Bracket	F9123GF	1	

ZR22G

Item	Parts. No.	Q'ty	Description			
Allen wrench	L9827AB	1	For lock screw			
70000						

ZR202G

Item	Parts. No.	Q'ty	Description		
Fuse	A1113EF	1	3.15 A		
Allen wrench	L9827AB	1	For lock screw		

# ■ Model and Code

Separate type General Parpose Zirconia **Oxygen / High Temperature Humidity** Analyzer, Converter

Model		Suffix code	Option code	Description
ZR402G	-			Separate type Zirconia Oxygen Analyzer, Converter
Converter thread	-  -( -  -	G M		G1/2 Pg13.5 M20x1.5 1/2NPT
Display		-J -F -G -F -C		Japanese English German French Chinese

Instruction manual	-J -E -C			Japanese English Chinese
—		-A		Always -A
Option			/HS	Set for Humidity Analyzer (*1)
			/H	Hood (*3)
Та	g pl	late	/SCT /PT	Stainless steel tag plate (*2) Printed tag plate (*2)
NAMUR compliar	AMUR NE43 mplian			Failure alarm down-scale: Output status at CPU failure and hardware error is 3.6 mA or less (*4)
			/C3	Failure alarm up-scale: Output status at CPU failure and hardware error is 21.0 mA or more (*4)
Sta	and	ard	/EQ /ER	EAC with PA (*5) EAC (*5)

- \*1 For humidity measurements, be sure to specify /HS options
- \*2 Specify either /SCT or /PT option code.
- \*3 Sun shield hood is still effective even if scratched.
- \*4 Output signal limits: 3.8 to 20.5 mA. Specify either /C2 or /C3 option code.
- \*5 "/EQ" is EAC with Pattern Approval for Russia. "/ER" is EAC for Kazakhstan and Belarus. (Note) If AC line voltage is 125 V AC or greater, or in the
- EEC, the ZO21D cannot be used with the ZR402G.

Language Model	Japanese	English	German	French
ZA8C	K9290LF	K9290KF	K9290MF	K9290MG
HA400 (kg)	K9293HT	K9293HU	K9293HW	K9293HV
HA400 (%)	K9293HP	K9293HQ	K9293HS	K9293HR
AV8V	K9296CN	K9296CN	K9296CN	K9296CN

- Note for ZR22G combination use with existing older model converters
- When the ZR22G is used with existing older model converters, ZA8C, AV8C and HA400, ROM replacement and addition of a cold junction temperature compensation board are required. The part numbers of each language version of ROM
- refer to table below.
- The part numbers of cold junction temperature compensation boards are K9471JA for the ZA8C
- For replacing the ROM by using ROM extraction tool (Part No. K9471JT) and mounting the cold junction temperature compensation board, it is recommended that you ask Yokogawa service station.

Model			Su	ffix co	ode				Option code	Description
ZR22G										Separate type Zirconia Oxygen/ High Temperature Humidity Analyzer, Detect
Length	-015							_		0.15 m (for high temperature use) (*1)
- <b>J</b> -	-040									0.4 m
	-070									0.7 m
	-100									1.0 m
	-150									1.5 m
	-200									2.0 m
	-250									2.5 m (*2)
	-300									3.0 m (*2)
	-360									3.6 m (*2)
	-420									4.2 m (*2)
	-480									4.8 m (*2)
	-540									5.4 m (*2)
Wetted ma	terial	-S								Stainless steel
		-C								Stainless steel with Inconel calibration gas tube (*10)
Flange			-A							ANSI Class 150 2 RF
(*3)			-B							ANSI Class 150 3 RF
(-)			-C							ANSI Class 150 4 RF
			-E							DIN PN10 DN50 A
			-F							DIN PN10 DN80 A
			-G							DIN PN10 DN100 A
			-K							JIS 5K 65 FF
			-L							JIS 10K 65 FF
			-M							JIS 10K 80 FF
			-P							JIS 10K 100 FF
			-Q							JIS 5K 32 FF (for high temperature use) (*4)
			-R							JPI Class 150 4 RF
			-S							JPI Class 150 3 RF
			-W							Westinghouse
Reference	aas			-C						Natural convection
	0			-E						External connection (Instrument air) (*11)
				-P						Pressure compensated (*11)
Gas Threa	d			<u> </u>	-R			_		Rc1/4
	u				-R					1/4NPT(Female)
Connodio	- houth				<u>'</u>			_		G1/2
Connectior	i box trife	au				-P -G				
						-G -M				Pg13.5 M20 x1.5
						-ivi -T				1/2 NPT
						-1 -Q				Quick connect (*9)
la sta stil										
Instruction	manual						-J			Japanese
							-E			English
							-C			Chinese
							-	-A		Always -A
Options									/C	Inconel bolt (*5)
							Valve	es	/CV	Check valve (*6)
									101	

#### 2. Separate type Zirconia Oxygen / High Temperature Humidity Analyzer, Detectors

\*1 \*2 Used with the ZO21P High Temperature Probe Adapter. Select flange (-Q). When installing horizontally the probe whose insertion length is 2.5 m or more, use the Probe Protector. Be sure to

Filter

Tag plates

Standard

/SV

/F1

/F2

/PT

/EQ

/ER

/SCT

specifyZO21R-L-200-□. Specify the flange suffix code either -C or -K. The thickness of the flange depends on its dimensions. Not used in conjunction with —P (pressure compensation) for reference gas. The flange thickness does not conform to JIS \*3 \*4 specification

Stop valve

Dust Filter

Dust Guard Protector

Printed tag plate

EAC with PA

EAC

Stainless steel tag plate (\*8)

(\*6)

(\*7)

(\*7)

(\*8)

(\*12)

(\*12)

Inconel probe bolts and U shape pipe are used. Use this option for high temperature use (ranging from 600 to 700 °C). Specify either /CV or /SV option code. \*5 \*6 \*7 \*8 \*9 \*10

Not used with the high temperature humidity analyzer. Specify either /SCT or /PT option code. Not waterproof, avoid rain. Operating maximum temperature is 80°C. Available only in the U.S. Recommended if sample gas contains corrosive gas like chlorine.

Piping for reference gas must be installed to supply reference gas constantly at a specified flow rate. "/EQ" is EAC with Pattern Approval for Russia. "/ER" is EAC for Kazakhstan and Belarus. \*11

\*12

Style : S2

Model		Su	ffix code			Option code	Description
ZR202G							Integrated type Zirconia Oxygen/ High Temperature Humidity Analyzer
Length	-040 -070 -100 -150 -200 -250 -300						0.4 m 0.7 m 1.0 m 1.5 m 2.0 m 2.5 m (*1) 3.0 m (*1)
Wetted mat	terial	-S -C					Stainless steel Stainless steel with Inconel calibration gas tube (*10)
Flange (*2)		- <b>А</b> -в-С- <u>п-</u> г-, -, <u>К</u> -г-, <u>К</u> -г					ANSI Class 150 2 RF ANSI Class 150 3 RF ANSI Class 150 4 RF DIN PN10 DN50 A DIN PN10 DN80 A DIN PN10 DN100 A JIS 5K 65 FF JIS 10K 65 FF JIS 10K 60 FF JIS 10K 100 FF JPI Class 150 4 RF JPI Class 150 3 RF Westinghouse
Auto Calibra	ation	-  -  -	4				Not required Horizontal mounting (*8) Vertical mounting (*8)
Reference	gas		-C -E -P				Natural convection External connection (Instrument air) (*11) Pressure compensated (*11)
Gas Thread	b		-F -Т	2			Rc1/4 1/4 NPT (Female)
Connection	box thre	ad		-P -G -M -T			G1/2 Pg 13.5 M20x1.5 1/2 NPT
Instruction r	manual				-J -E -C		Japanese English Chinese
					-A		Always -A
Options						/C	Inconel bolt (*3)
						/HS	Set for Humidity Analyzer (*4)
					Valves	/CV /SV	Check valve (*5) Stop valve (*5)
						/H	Hood (*9)
						/F1 /F2	Dust Filter (*6) Dust Guard Protector (*6)
				Тар	g plates	/SCT /PT	Stainless steel tag plate (*7) Printed tag plate (*7)
			NAMUR	NE43 coi	mpliant	/C2 /C3	Failure alarm down-scale: Output status at CPU failure and hardware error is 3.6 mA or less (*12) Failure alarm up-scale: Output status at CPU failure and hardware error is 21.0 mA or more (*12)
				S	standard	/EQ /ER	EAC with PA (*13) EAC (*13)

#### 3. Integrated type Zirconia Oxygen / High temperature Humidity Analyzer

\*1 For the horizontally installed probe whose insertion length is 2.5 m or more, use the Probe Protector. Be sure to specify ZO21R-L-200-□. Specify the flange suffix code either -C or -K.

The thickness of the flange depends on its dimensions.

Inconel probe bolts and U shape pipe are used. Use this option for high temperature use (ranging from 600 to 700°C).

\*2 \*3 \*4 \*5 \*6 \*7 For humidity measurements, be sure to specify /HS options. Pressure compensation of reference gas can not be selected.

Specify either /CV or /SV option code.

Not used with the high temperature humidity analyzer.

Specify either /SCT or /PT option code.

\*8 No need to specify the option codes, /CV and /SV, since the check valves are provided with the Automatic Calibration Unit. Automatic calibration cannot be used when natural convection is selected as reference air.

\*9 Sun shield hood is still effective even if scratched. Hood is necessary for outdoor installation out of sun shield roof.

\*10 Recommended if sample gas contains corrosive gas like chlorine.

\*11 Piping for reference gas must be installed to supply reference gas constantly at a specified flow rate.

\*12 Output signal limits: 3.8 to 20.5 mA. Specify either /C2 or /C3 option code.

"/EQ" is EAC with Pattern Approval for Russia. "/ER" is EAC for Kazakhstan and Belarus. \*13

#### 4. High Temperature Probe Adapter for Separate type Oxygen Analyzer

Model	Sı	uffix	code	Option code	Description		
ZO21P	-ŀ	4			High Temperature Probe Adapter		
Material		-A -B					SiC SUS 310S (JIS)
Insertion length	1	-050 -060 -070 -080 -090 -100 -150			0.5 m 0.6 m 0.7 m 0.8 m 0.9 m 1.0 m 1.5 m		
Flange			┐҄҇҄҇҄҄҄҄҄҄҄҄ <sup>ๅ</sup> ҇҇҄ <sup>ๅ</sup> ҇҄ <sup>ๅ</sup> <sup>ๅ</sup> <sup>ๅ</sup> <sup>ๅ</sup> <sup>ๅ</sup> <sup>ๅ</sup> <sup>ๅ</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup> <sup>¬</sup>		JIS 5K 50 FF JIS 10K 65 FF JIS 10K 80 FF JIS 10K 100 FF ANSI Class 150 4 RF ANSI Class 150 2 1/2 RF ANSI Class 150 3 RF JPI Class 150 3 RF JPI Class 150 4 RF DIN PN10 DN50 A		
Style co	de		*В		Style B		
Option			Ejector g plate	/EJ1 /EJ2 /SCT	Ejector Assy with E7046EC Ejector Assy with E7046EN Stainless steel tag plate		

Note: For this high-temperature use probe adapter, be sure to specify the ZR22G probe of its insertion length 0.15 meters.

#### High Temperature Probes (Spare Parts)

Part No.	Description
K9292TP	SiC, insertion length 0.5 m
E7046CF	SiC, insertion length 0.6 m
K9292TQ	SiC, insertion length 0.7 m
E7046CG	SiC, insertion length 0.8 m
E7046CH	SiC, insertion length 0.9 m
E7046AL	SiC, insertion length 1.0 m
E7046BB	SiC, insertion length 1.5 m
K9292TV	SUS310S (JIS), insertion length 0.5 m
E7046CR	SUS310S (JIS), insertion length 0.6 m
K9292TW	SUS310S (JIS), insertion length 0.7 m
E7046CS	SUS310S (JIS), insertion length 0.8 m
E7046CT	SUS310S (JIS), insertion length 0.9 m
E7046AP	SUS310S (JIS), insertion length 1.0 m
E7046AQ	SUS310S (JIS), insertion length 1.5 m

# 5. Ejector Assembly or High Temperature Use of separate type Oxygen Analyzer

Part No.	Description
E7046EC	Needle valve; Rc1/4, Pressure gauge; R1/4, Ejector; Ø6/Ø4 mm TUBE joint: SUS304 (JIS)
E7046EN	Needle valve; 1/4 NPT(F), Pressure gauge;1/4 NPT(M), Ejector; 1/4 TUBE joint: SUS304 (JIS)

#### 6. Probe Protector for Zirconia Oxygen Analyzers

Model	Suffix code			Option code	Description
ZO21R	-L	-L			Probe Protector (0 to 700°C)
Insertion length	I	-100 -150 -200			1.05 m 1.55 m 2.05 m
Flange (	*1)	1) -J -A			JIS 5K 65 FF ANSI Class 150 4 FF
Style co	de				Style B

\*1 Thickness of flange depends on dimensions of flange.

#### 7. Dust Filter for Zirconia Oxygen Analyzers

Part No.	Description
K9471UA	Filter
K9471UX	Tool

#### 8. Dust Guard Protector

Part No.	Description
K9471UC	Dust guard protector

# 9. Dust Protector for High Temperature Humidity Analyzers

Model	-	uffix ode	Option code	Description				
ZH21B				Dust Protector (0 to 600°C)				
Insertion length	-040			0.440 m				
Flange	-J -A			JIS 5K 80 FF *(1) ANSI Class 150 4B FF *(2)				
Style code	e *B		e *B		e *B			Style B

\* The flange thickness varies.

Specify the probe ZR22G-040-□-K or ZR202G-040-□-K in case of (1) ZR22G-040-□-C or ZR202G-040-□-C in case of (2)

# 10. Standard Gas Unit

Model		ffix de	Option code	Description
ZO21S				Standard gas unit
Power supply	-2 -3 -4 -5 -7 -8			200 V AC 50/60 Hz 220 V AC 50/60 Hz 240 V AC 50/60 Hz 100 V AC 50/60 Hz 110 V AC 50/60 Hz 115 V AC 50/60 Hz
Panel	-J -E			Japanese version English version
Style code *A		*A		Style A

# 11. Flow Setting Unit for manual calibration (Needs instrument air.)

Model	Suffix code				Option code	Description
ZA8F				Flow setting unit		
Joint	-J -A			Rc1/4 With 1/4 NPT (F) adapter		
Style code		*C		Style C		

# 12. Automatic Calibration Unit for Separate type Analyzer (Needs instrument air.)

Model	Suffix code			Option code	Description
ZR40H					Automatic calibration unit for ZR402G
Gas piping connection	-R -T				Rc1/4 1/4 NPT (F)
Wiring connection		-P -G -M -T			G1/2 Pg 13.5 M20 x 1.5 1/2 NPT
			-A		Always -A

# 13. Automatic Calibration Unit for Integrated type Analyzer (Needs instrument air.)

Model	Suffix code				Option code	Description				
ZR20H										Automatic calibration unit for ZR202G *1
Gas piping connection		-R -T				Rc1/4 1/4 NPT (F)				
Reference a *2	air	air -E -P				Instrument air Pressure compensated				
Mounting				A B		Horizontal mounting Vertical mounting				
_				-A		Always -A				

\*1 Ask Yokogawa service station for additional mounting of ZR20H to the preinstalled ZR202G.

\*2 Select the appropriate reference gas of ZR20H according to the one of ZR202G.

# 14. Stop Valve for Calibration gas line

Part No.	Description
L9852CB	Joint: Rc1/4, Material: SUS316 (JIS)
G7016XH	Joint: 1/4 NPT (F), Material: SUS316 (JIS)

Part No.	Description
G7209XA	Nipple: R1/4, Material: SUS304 (JIS)
K9470ZN	Nipple: 1/4 NPT, Material: SUS304 (JIS)

# 15. Check Valve for Calibration-gas line

	Part No.	Description
ł	K9292DN	Joint: Rc1/4, Material: SUS304 (JIS)
ł	K9292DS	Joint: 1/4 NPT (F), Material: SUS304 (JIS)

### 16. Air Set

Part No.	Description
G7003XF	Joint: Rc1/4, Material: Zinc alloy
K9473XK	Joint: 1/4 NPT (F), Material: Zinc alloy with adapter
G7004XF	Joint: Rc1/4, Material: Zinc alloy
K9473XG	Joint: 1/4 NPT (F), Material: Zinc alloy with adapter

# 17. Zero gas Cylinder

Part No.	Description
G7001ZC	3.4 I container, 0.95 to 1.0 vol % $O_2$ , $N_2$ -balanced.
<b>.</b> .	

(Note) Export of such high pressure filled gas cylinders to most countries is prohibited or restricted.

#### 18. Pressure Regulator for Gas Cylinder

Part No.	Description
G7013XF	Inlet: W22 14 threads, Outlet: Rc1/4
G7014XF	Inlet: W22 14 threads, Outlet: 1/4 NPT (F)

# 19. Case Assembly for Calibration-gas Cylinder

[	Part No.	Description
	E7044KF	Calibration gas unit case

(Note) Export of such high pressure filled gas cylinders to most countries is prohibited or restricted.

#### 20. Heater Assembly

Style: S2

Model				Option code	Description
ZR22A					Heater Assembly for ZR22G
Length (*1)	-015 -040 -070 -100 -150 -250 -250 -300	) ) ) )			0.15 m 0.4 m 0.7 m 1 m 1.5 m 2 m 2.5 m 3 m
Jig for change		-A -N			with Jig (*2) None
Reference gas (*3)			-A -B -C		Natural convention, External connection (Instrument air) Pressure compensated (for ZR22G S2) Pressure compensated (for ZR22G S1)


\*1 Suffix code of length should be selected as same as ZR22G installed.
\*2 Jig part no. is K9470BX to order as a parts after purchase.
\*3 Select appropriately among "-A", "-B", "-C" according to the reference gas supply method and style.
(Note) The heater is made of ceramic, do not drop or subject it to pressure stress.

Model	Suffix	code	Option code	Description
ZR202A				Heater Assembly for ZR202G
Length (*1)	-040 -070 -100 -150 -200 -250 -300			0.4 m 0.7 m 1 m 1.5 m 2 m 2.5 m 3 m
Jig for change		A N		with Jig (*2) None
—		-A		Always -A

\*1 Suffix code of length should be selected as same as ZR202G installed. \*2 Jig part no. is K9470BX to order as a parts after purchase. (Note) The heater is made of ceramic, do not drop or subject it to pressure stress.

### **EXTERNAL DIMENSIONS**

1. Model ZR22G Separate type Zirconia Oxygen / High Temperature Humidity Analyzer, **Detectors** 

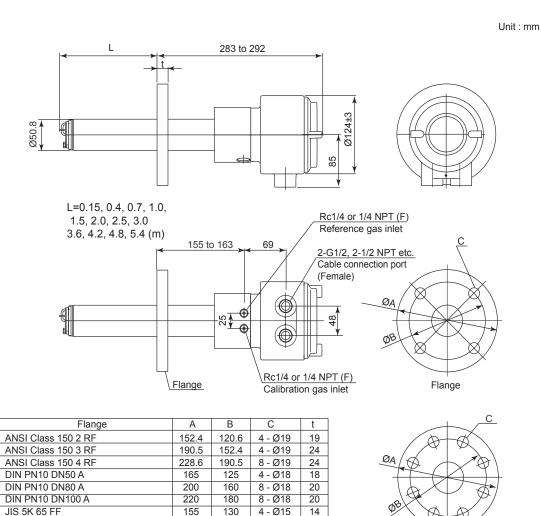

130

140

150

175

90

190.5

152.4

127

175

185

210

115

229

190

155

4 - Ø15

4 - Ø19

8 - Ø19

8 - Ø19

4 - Ø15

8 - Ø19

4 - Ø19

4 - Ø11.5

14

18

18

18

5

24

24

14

Flange

( )

F07 01.ai

JIS 10K 65 FF

JIS 10K 80 FF

JIS 10K 100 FF


JPI Class 150 4 RF


JPI Class 150 3 RF

JIS 5K 32 FF

Westinghouse




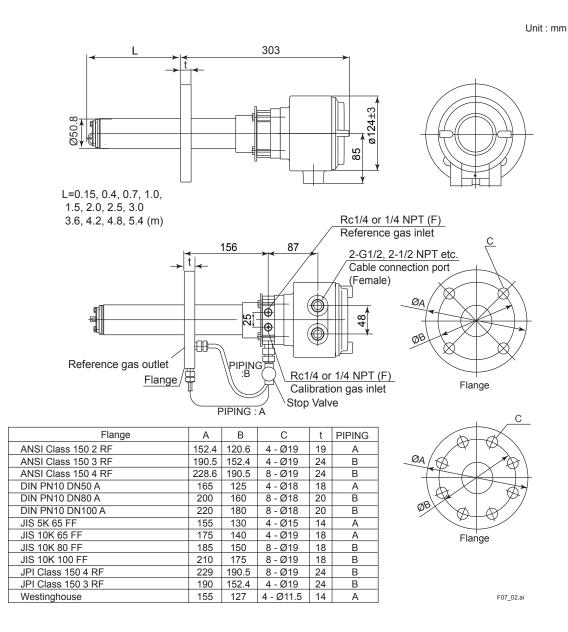


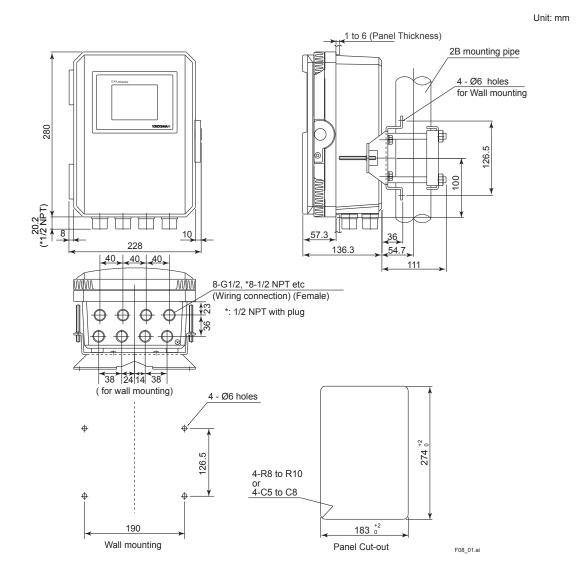

2. Model ZR402G Separate type Zirconia Oxygen/ High Temperature Humidity Analyzer, Converter


•With sun shield hood (option code /H)

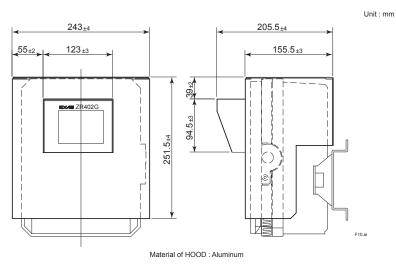

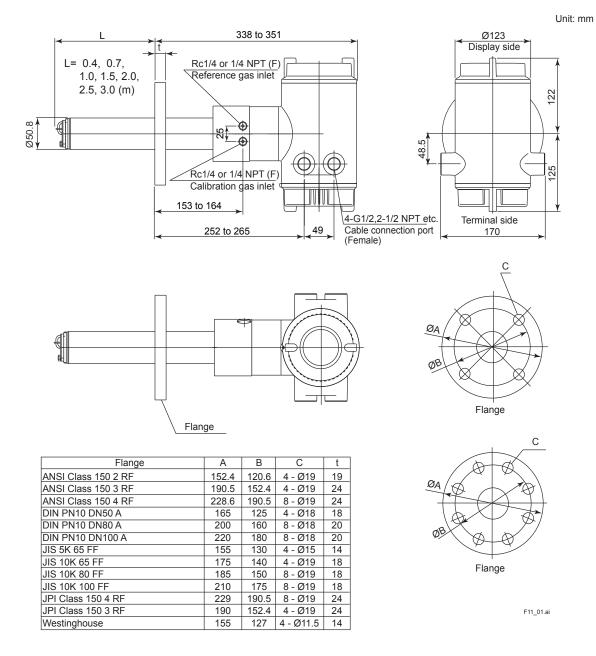


### 3. Model ZR202G Integrated type Zirconia Oxygen/ High Temperature Humidity Analyzers




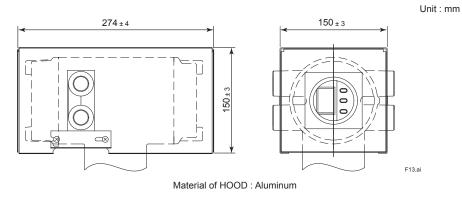



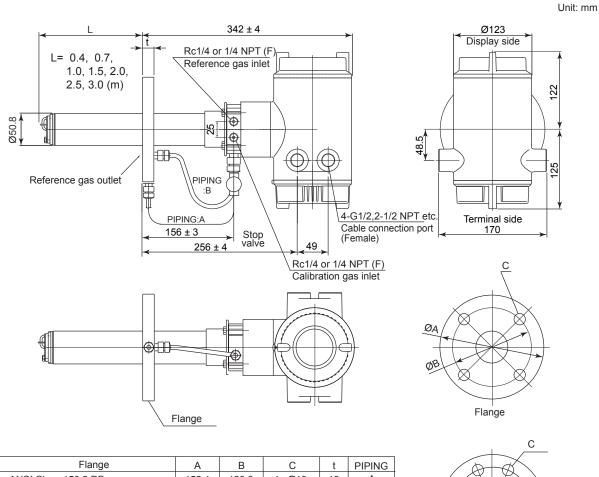


Flange	A	В	С	t	PIPING
ANSI Class 150 2 RF	152.4	120.6	4 - Ø19	19	Α
ANSI Class 150 3 RF	190.5	152.4	4 - Ø19	24	В
ANSI Class 150 4 RF	228.6	190.5	8 - Ø19	24	В
DIN PN10 DN50 A	165	125	4 - Ø18	18	A
DIN PN10 DN80 A	200	160	8 - Ø18	20	В
DIN PN10 DN100 A	220	180	8 - Ø18	20	В
JIS 5K 65 FF	155	130	4 - Ø15	14	A
JIS 10K 65 FF	175	140	4 - Ø19	18	A
JIS 10K 80 FF	185	150	8 - Ø19	18	В
JIS 10K 100 FF	210	175	8 - Ø19	18	В
JPI Class 150 4 RF	229	190.5	8 - Ø19	24	В
JPI Class 150 3 RF	190	152.4	4 - Ø19	24	В
Westinghouse	155	127	4 - Ø11.5	14	Α

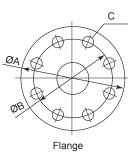


F11\_02.EPS

### 4. Model ZO21P Adapter for High Temperature Probe of separate type Oxygen Analyzer

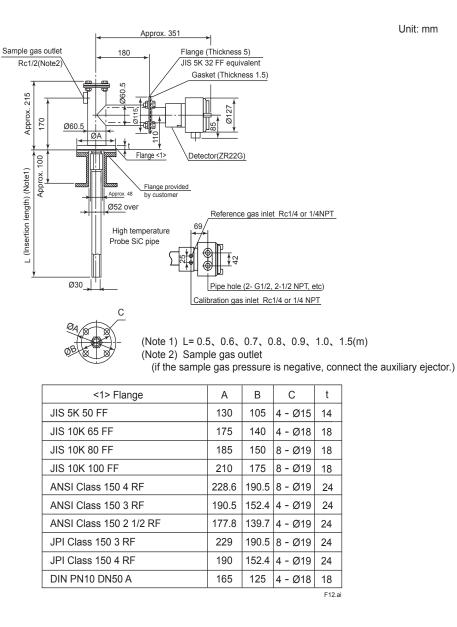


# 5. E7046EC, E7046EN Auxiliary Ejector Assembly for High Temperature Detector of separate type Oxygen Analyzer

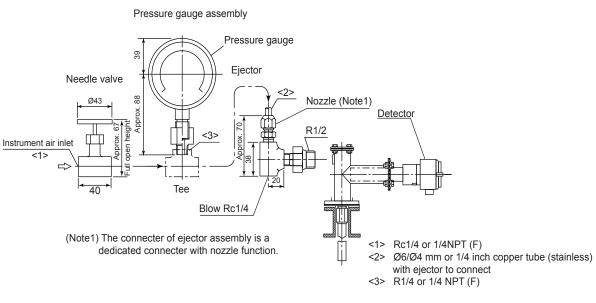


F19.ai

#### 6. Model ZO21R Probe Protector for Zirconia Oxygen Analyzers

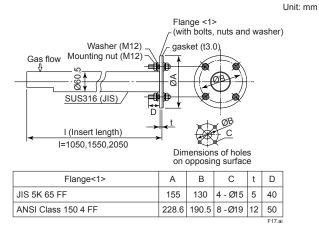


#### 7. K9471UA Dust Filter for Oxygen Analyzer

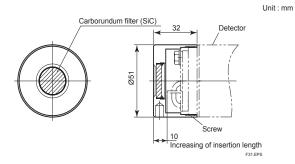


Unit : mm

#### 8. K9471UC Dust Guard Protector

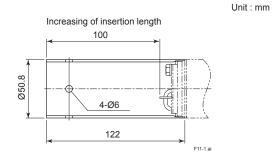

#### 9. Model ZH21B Dust Protector for High Temperature Humidity Analyzers

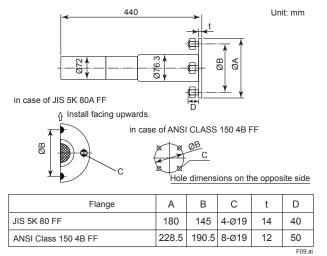


#### 10. Model ZO21S Standard Gas Unit

Tero gas cylinder (6 cylinder): E7050BA

All Rights Reserved. Copyright © 2000, Yokogawa Electric Corporation

Unit : mm


#### 11. Model ZA8F Flow setting unit for manual calibration

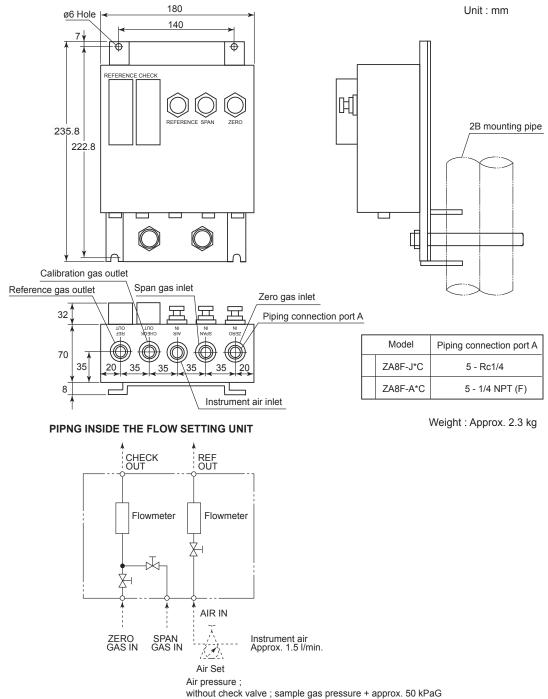

with check valve ; sample gas pressure + approx. 50 kPaG


F2.6E.ai

#### 12. Model ZR40H Automatic Calibration Unit for Separate type Analyzer

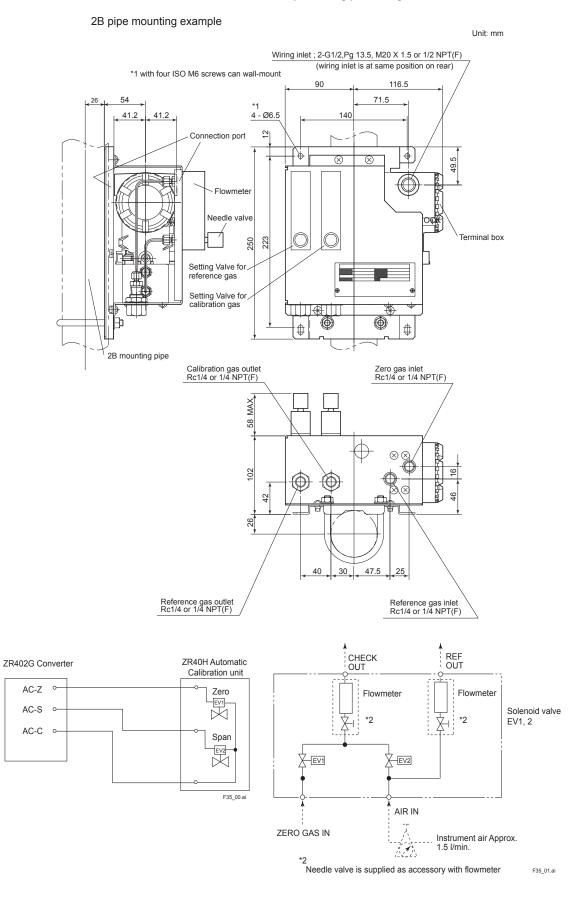


### 13. Model ZR20H Automatic Calibration Unit for Integrated type Analyzer


Horizontal mounting on the ZR202G (-A)

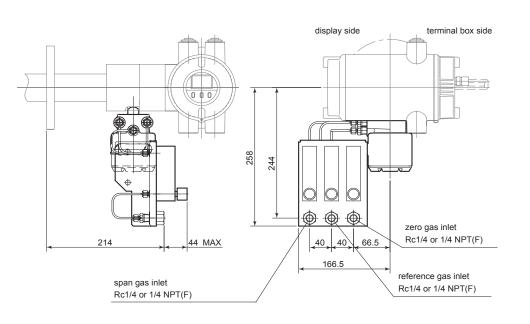

Vertical mounting on the ZR202G (-B)

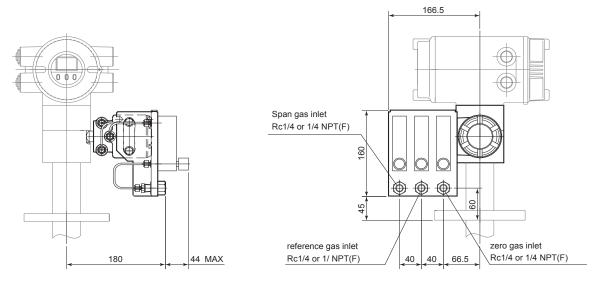


### 14. L9852CB /G7016XH Stop Valve for Calibration gas line

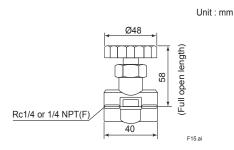


Unit: mm


#### 15. K9292DN /K9292DS Check Valve for Calibration-gas line

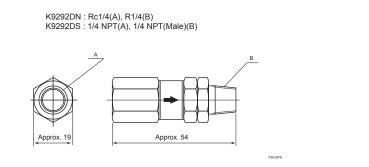

### 16. G7003XF/K9473XK, G7004XF/K9473XG Air Set

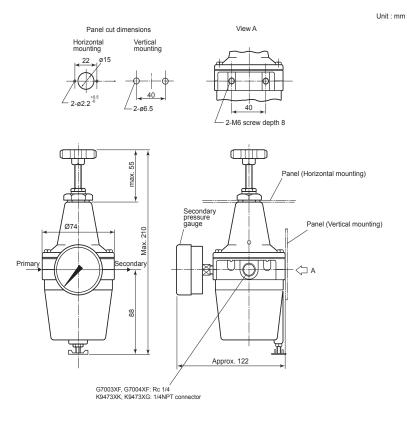

### 17. G7001ZC Zero gas Cylinder

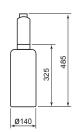


Unit : mm


(Note) Export of such high pressure filled gas cylinders to most countries is prohibited or restricted.

Unit: mm

#### 18. G7013XF, G7014XF Pressure Regulator for Gas Cylinder

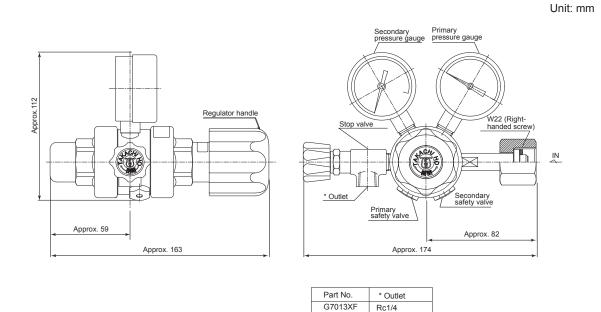

### 19. E7044KF Case Assembly for Calibration gas Cylinder

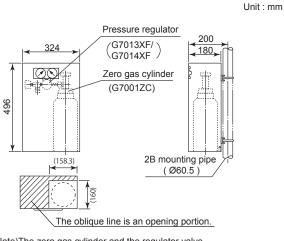

G7014XF


1/4 NPT (F)

F23.ai

35


<sup>(</sup>Note)The zero gas cylinder and the regulator valve are not included in the E7044KF (case assembly)

# WIRING CONNECTIONS

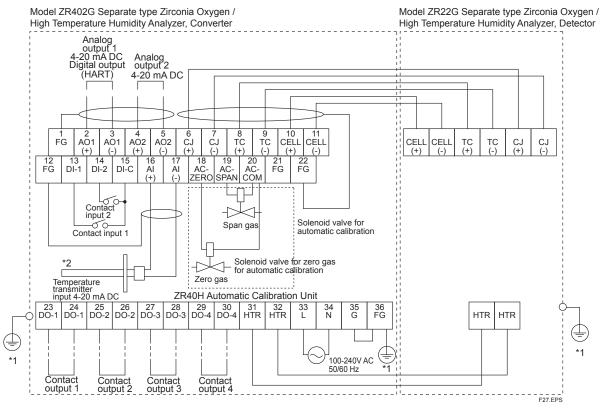

\*1 Grand resistance is 100 ohm or less.

\*2 Option (Temperature transmitter provide by user) for humidity measurement.

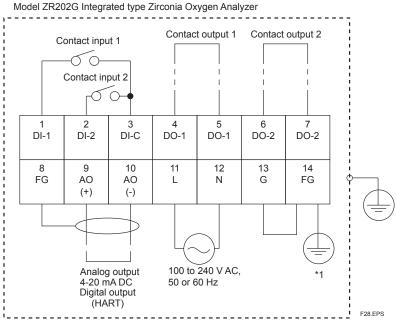

The protective grounding for the analyzer shall be connected either the protective ground terminal in the equipment or the ground terminal on the case.

Standard regarding grounding: Ground to earth, ground resistance:  $100\Omega$  or less.

Inquiry Sheet for Models ZR22G, ZR402G, and ZR202G Direct In Situ Zirconia Oxygen Analyzers and High Temperature Humidity Analyzers

Please place checkmarks in the appropriate boxes and fill in the necessary information in the blanks.

General informati Customer	ion					laryzor	. 🗆 🗸	., 90	alyzer 🗆 High Terr	iporataro i i	
Destination of	of delivery						□ Se	eparate ty	pe   Integrated ty	/pe	
Plant name					Object :		🗆 ine	dication D	□ record □ control	□ alarm	
Measuremer	at points				Fuel :		🗆 ga	s □ oil □	coal □		
weasuremen	it points				Power red	uireme	ents	V AC	Hz		
2. Process conditi	ons										
2.1 Measure	ment gas compon	nents									
2.2 Oxygen	concentration	Nor.		Min.			Max.		□ vol% O2,		
Moisture	e contents	Nor.		Min.			Max.		□ kg/kg,	□ Vol%	H <sub>2</sub> O
2.3 Tempera	ture	Nor.		Min.			Max.		□ °C,		
2.4 Pressure	)	Nor.		Min.			Max.		□ kPa,		
2.5 Gas flow		Nor.		Min.			Max.		□ m/sec,		
2.6 Dust type	e, Size	Nor.		Min.		mm	quan	tity	g/Nm <sup>3</sup> ,		
2.7 Corrosiv		□ No gas	□ Gas				, quant	ity			
	- 3	0.1					, quant		ppm,		
2.9 Combus	tible geo	□ No gas	□ Gas				, quant		ppm,		
2.8 Combus	suble gas								ppm,		
2.9 Others							, quant		ppm,		
0.1 Ambient	t temperature	1. Around Pro			to	°C,	2. 74		verter temp. from	to	°C
2 Probe 3 Probe 4 Flang	e installation locati e position e insertion length ( ge ent air supply	ion	Furr Hori Indo 0.4, DIN	nace zontal por 0.7	used. 🗆 C	or $\Box$ C $\Box$ 1.4 ANSI Can be	thers overed 5, □ : used.	2.0, □ 2	2.5, □ 3.0, □ 3.0 □ Others kPa		□ 4.8, [
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location	ion (m) (Note)	Furr     Hori     Indo     0.4,     DIN     Can     Indo	nace zontal por 0.7	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor	I □ 0 or □ C □ 1.4 ANSI_ Can be	thers overed 5, □ : used.	2.0, □ 2	Others kPa		□ 4.8, [
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable let</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ungth between pro	ion (m) (Note)	Furr     Hori     Hori     Indo     0.4,     DIN     Can     Indo	nace zontal por 0.7 not be por	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor □	I □ 0 or □ C □ 1.{ ANSI Can be □ C eters	thers overed 5, □ : used.	2.0, □ 2	Others kPa		□ 4.8, [ 
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable le</li> <li>3.7 Calibrati</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ength between pro ion method	ion (m) (Note) be and converte	Furr     Hori     Indc     0.4,     DIN     Can     Indc     IIndc     Indc     III     IIIIIIIIIIIIIIIIIIIIIIIII	nace zontal por 0.7 not be por	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor	I □ 0 or □ C □ 1.{ ANSI Can be □ C eters	thers overed 5, □ : used.	2.0, □ 2	Others kPa		□ 4.8, [ 
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable le</li> <li>3.7 Calibrati</li> <li>(Note) 3.6</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ungth between pro	ion (m) (Note) be and converte	Furr     Hori     Indc     0.4,     DIN     Can     Indc     IIndc     Indc     III     IIIIIIIIIIIIIIIIIIIIIIIII	nace zontal por 0.7 not be por	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor □	I □ 0 or □ C □ 1.{ ANSI Can be □ C eters	thers overed 5, □ : used.	2.0, □ 2	Others kPa		☐ 4.8, [ 
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable le</li> <li>3.7 Calibrati</li> <li>(Note) 3.6</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ength between pro ion method	ion (m) (Note) be and converte lable only in the	Furr     Hori     Indc     0.4,     DIN     Can     Indc     IIndc     Indc     III     IIIIIIIIIIIIIIIIIIIIIIIII	nace zontal por 0.7 not be por	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor □	I □ 0 or □ C □ 1.{ ANSI Can be □ C eters	thers overed 5, □ : used.	2.0, 2	kPa kPa	5	□ 4.8, [ 
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable le</li> <li>3.7 Calibrati</li> <li>(Note) 3.6</li> <li>Quotation data</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail	ion (m) (Note) be and converte lable only in the Quotation	Furr     Hori     Indc     0.4,     OI.4     Can     Indc     Indc     r     U.S.	nace zontal por 0.7 not be por	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor □	I □ 0 or □ C □ 1.{ ANSI Can be □ C eters	thers overed 5, □ : used.	2.0, □ 2	Others	scription	
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable le</li> <li>3.7 Calibrati</li> <li>(Note) 3.6</li> <li>Quotation data</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail	ion (m) (Note) be and converte lable only in the Quotation eneral-use Prot	Furr     Hori     Indc     0.4,     OIN_     Can     Indc er     U.S.	nace zontal por not be por [ nual	□ Vertical □ Outdoc 7, □ 1.0, used. □ C □ Outdoor □ Outdoor □ Automati	I □ 0 or □ C □ 1.{ ANSI Can be □ C eters	thers overed 5, □ : used.	2.0, 2	kPa kPa	scription	
<ul> <li>3.3 1 Probe</li> <li>2 Probe</li> <li>3 Probe</li> <li>4 Flang</li> <li>3.4 Instrume</li> <li>3.5 Convert</li> <li>3.6 Cable le</li> <li>3.7 Calibrati</li> <li>(Note) 3.6</li> <li>Quotation data</li> </ul>	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail Model ZR22G G Model ZR22P-H	ion (m) (Note) be and converte lable only in the Quotation eneral-use Prot High Temperat	Furr     Hori     Indc     0.4,     DIN     Can     Indc er     U.S.  De ure Probe	Adapte	□ Vertical □ Outdoc 7, □ 1.0, □ used. □ C □ Outdoor □ Outdoor □ Automati	I □ O or □ C ANSI Can be □ C eters ic	thers overed 5, □ : used.	2.0, 2	C Others	scription	
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail	ion (m) (Note) be and converte lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass	Furr     Hori     Indc     0.4,     DIN     Can     Indc er     U.S.   De ure Probe sembly for	Adapte	Vertical Outdoc , , I.O., Used. Outdoor Outdoor Automati er emperature	I □ O O O O O O O O O O O O O O O O O O	thers	2.0, 2	C Others	scription	
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data robe	e installation locati e position e insertion length ( ge ent air supply er location angth between pro ion method m or more is avail Model ZR22G G Model ZR22G G Model ZC21P-H E7046EC /E704	ion (m) (Note) be and converte lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for	Furr Furr Hori O.4, O.4, Can Can Can Can And And And And And And And And And An	Adapte high te	Vertical Outdoc , , , , , , , , , , , , , , , , , , ,	I □ O O O O O O O O O O O O O O O O O O	thers	2.0, 2	C Others	scription	
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail Model ZR22G G Model ZR22G C Model ZR22B D	ion (m) (Note) be and converte lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for robe Protector f	Furr     Hori     Indc     O.4,     OIN_     Can     Indc     O.4,     Mar     U.S.     Ore     Ure Probe     sembly for     r High Tem     for Oxgen A	Adapte high te	Vertical Outdoc , , , , , , , , , , , , , , , , , , ,	I □ O O O O O O O O O O O O O O O O O O	thers	2.0, 2	C Others	scription	
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data robe	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail Model ZR22G G Model ZR22G G Model ZC21P-H E7046EC /E704 Model ZH21B Di Model ZO21R Pi	ion (m) (Note) be and converte lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for robe Protector for for Oxgen Analy	Furr     Hori     Indc     O.4,     OIN_     Can     Indc     O.4,     Mar     U.S.     Ore     Ure Probe     sembly for     r High Tem     for Oxgen A	Adapte high te	Vertical Outdoc , , , , , , , , , , , , , , , , , , ,	I □ O O O O O O O O O O O O O O O O O O	thers	2.0, 2	C Others	scription	
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data robe	e installation locati e position e insertion length i ge ent air supply er location ingth between pro- ion method m or more is avail Model ZR22G G Model ZR22G G Model ZC21P-H E7046EC /E7044 Model ZH21B Di Model ZO21R Pri K9471UA Filter f eparate type Analy tegrated type Zirci	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prote High Temperation 6EN Ejector Assist ust Protector for robe Protector for robe Protector for robe Protector for ro Oxgen Analy yzer, Converter	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I 🗌 O O O O O T 🗌 C O O T 🗌 C O O T 🗌 C O O O O O O O O O O O O O O O O O O	thers	2.0, 2	C Others	scription	
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data robe	e installation locati e position e insertion length i ge ent air supply er location angth between pro- ion method m or more is avail Model ZR22G G Model ZR22G G Model ZC21P-H E7046EC /E704 Model ZH21B Di Model ZH21B Di Model ZH21B Di Model ZH21B Di K9471UA Filter f eparate type Analy tegrated type Zirci ndard Gas Unit	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prote High Temperation 6EN Ejector Assist ust Protector for robe Protector for robe Protector for robe Protector for ro Oxgen Analy yzer, Converter	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I 🗌 O O O O O T 🗌 C O O T 🗌 C O O T 🗌 C O O O O O O O O O O O O O O O O O O	thers	2.0, 2	Others	scription be Configur on.	ation
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data Probe	e installation locati e position e insertion length i ge ent air supply er location ingth between pro- tion method m or more is avail Model ZR22G G Model ZR22G G Model ZC21P-H E7046EC /E704/ Model ZO21P-H E7046EC /E704/ Model ZO21R Pri K9471UA Filter f eparate type Analy tegrated type Zirco indard Gas Unit Setting Unit	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prot High Temperatu 6EN Ejector Ass ust Protector for robe Protector for for Oxgen Analy yzer, Converter onia Oxygen /H	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I □ 0 1.1.1	thers	2.0, 2	Others	scription be Configur on.	ation
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 Quotation data robe Options (for general use) odel ZR402G Se odel ZR202G In odel ZR202G In odel ZR202G Sta odel ZR40H, ZR	e installation locati e position e insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail Model ZR22G G Model ZR22G G Model ZO21P-H E7046EC /E704 Model ZH21B Du Model ZO21R Pi K9471UA Filter f eparate type Analy tegrated type Zirco ndard Gas Unit Setting Unit 20H Automatic Ca	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prot High Temperatu 6EN Ejector Ass ust Protector for robe Protector for for Oxgen Analy yzer, Converter onia Oxygen /H	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I □ 0 1.1.1	thers	2.0, 2	Others	scription be Configur on. of Model ZO R20H.	ation 21S,
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 . Quotation data Probe Options (for general use) Iodel ZR402G Se Iodel ZR402G Se	e installation locati e position a insertion length ( ge ent air supply er location ingth between pro ion method m or more is avail Model ZR22G G Model ZO21P-H E7046EC /E704 Model ZO21P PI E7046EC /E704 Model ZO21R PI K9471UA Filter f eparate type Analy tegrated type Zirco ndard Gas Unit Setting Unit 20H Automatic Ca KH Stop Valve	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for robe Protector for robe Protector for robe Protector for on Oxgen Analy yzer, Converter onia Oxygen /H	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I □ 0 1.1.1	thers	2.0, 2	Others	scription be Configur on. of Model ZO R20H.	ation 21S,
3.3 1 Probe 2 Probe 3 Probe 4 Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 . Quotation data Probe Options (for general use) Nodel ZR402G Se Nodel ZR40	e installation locati e position a insertion length ( ge ent air supply er location ingth between pro- ion method m or more is avail Model ZR22G G Model ZO21P-H E7046EC /E704 Model ZO21P-H E7046EC /E704 Model ZO21R Pi K9471UA Filter f eparate type Analy tegrated type Zirci ndard Gas Unit Setting Unit 20H Automatic Cas KH Stop Valve	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for robe Protector for robe Protector for on Oxgen Analy yzer, Converter onia Oxygen /H alibration Unit	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I □ 0 1.1.1	thers	2.0, 2	Others kPa Dof)  Refer to the Prot for probe selection    Select any one of ZA8F, ZR40H, ZI 	scription be Configur on. of Model ZO R20H.	ation 21S,
3.3 1 Probe 2 Probe 3 Probe 3 A Flang 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 . Quotation data Probe Options (for general use) Iodel ZR402G Se Iodel ZR	e installation locati e position a insertion length ( ge ent air supply er location ingth between pro- ion method m or more is avail Model ZR22G G Model ZR22G G Model ZO21P-H E7046EC /E704 Model ZO21P PI E7046EC /E704 Model ZO21R PI K9471UA Filter f eparate type Analy tegrated type Zirci ndard Gas Unit Setting Unit 20H Automatic Cas KH Stop Valve DS Check Valve (' K, G7004XF/K94'	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for robe Protector for robe Protector for on Oxgen Analy yzer, Converter onia Oxygen /H alibration Unit	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I □ 0 1.1.1	thers	2.0, 2	Others kPa Dof)  Refer to the Prot for probe selection    Select any one of ZA8F, ZR40H, ZI 	scription be Configur on. of Model ZO R20H.	ation 21S,
3.3 1 Probe 2 Probe 3 Probe 3.4 Instrume 3.5 Convert 3.6 Cable le 3.7 Calibrati (Note) 3.6 . Quotation data Probe Options (for general use) lodel ZR402G Se lodel ZR402G Se lo	e installation locati e position a insertion length ( ge ent air supply er location ingth between pro- ion method m or more is avail Model ZR22G G Model ZR22G G Model ZO21P-H E7046EC /E704 Model ZO21P PI E7046EC /E704 Model ZO21R PI K9471UA Filter f eparate type Analy tegrated type Zirci ndard Gas Unit Setting Unit 20H Automatic Cas KH Stop Valve DS Check Valve (' K, G7004XF/K94'	ion (m) (Note) be and converter lable only in the Quotation eneral-use Prot High Temperati 6EN Ejector Ass ust Protector for robe Protector for robe Protector for robe Protector for robe Protector for on Oxgen Analy yzer, Converter onia Oxygen /H alibration Unit *1) 73XG Air Set	Furr     Hori     Indc     O.4,     DIN     Can     Indc     O.4,     Mar     U.S.	Adaptee hipperatu	Vertical Outdoc , Outdoc , I.O., Used. Outdoor Outdoor Outdoor Automati er emperature ire Humidity er	I □ 0 1.1.1	thers	2.0, 2	Others kPa Dof)  Refer to the Prot for probe selection    Select any one of ZA8F, ZR40H, ZI 	scription be Configur on. of Model ZO R20H.	ation 21S,

\*1 When Automatic Calibration of "-A" or "-B" code is specified, ZR20H is installed in ZR202G.

\*2 Export of such high pressure filled gas cylinders to most countries is prohibited or restricted.